

RHI HOME INSPECTIONS

8127740804 office@yourrhi.com https://www.yourrhi.com



INSPECTION REPORT

816 Southfield Rd Evansville, IN 47715

> Chris Rhoades 07/23/2025



Inspector Rowdy Abbott HI02100086, F282058 8127740804 office@yourrhi.com



Cara Gile Berkshire Hathaway Home Services

TABLE OF CONTENTS

1: Inspection Details	D
2: Exterior	10
3: Grounds	13
4: Garage	16
5: Roof & Chimneys	20
6: Attic	23
7: HVAC & Fireplaces	27
8: Electrical	31
9: Plumbing	38
10: Interior	41
11: Bathrooms	45
12: Kitchen	48
13: Laundry	51
14: Foundation	52
15: Environmental	58
16: Fire Safety	61
17: End of Inspection Checklist	62
Standards of Practice	63

SUMMARY

- 2.1.1 Exterior Siding: Siding Maintenance Needed
- 2.1.2 Exterior Siding: Siding Minor Damage
- 2.2.1 Exterior Fascia, Soffit, Trim, & Columns: Trim Maintenance Needed
- 2.2.2 Exterior Fascia, Soffit, Trim, & Columns: Vent Cover(s) Improper Clearance
- 2.2.3 Exterior Fascia, Soffit, Trim, & Columns: Vent Cover(s) Loose / Unsealed
- 2.3.1 Exterior Windows: Window(s) Maintenance Needed
- 2.4.1 Exterior Exterior Doors: Door(s) Maintenance Needed
- 3.1.1 Grounds Driveways, Walkways & Patios: Driveway Minor Cracking
- 3.1.2 Grounds Driveways, Walkways & Patios: Walkway(s) Minor Cracking
- 3.1.3 Grounds Driveways, Walkways & Patios: Patio(s) Minor Cracking
- 3.1.4 Grounds Driveways, Walkways & Patios: Concrete Missing / Deteriorating Expansion Filler
- 3.2.1 Grounds Grading / Drainage: Grading Siding Contact
- 4.1.2 Garage Walls, Ceiling, & Firewalls: Wall(s) Minor Damage
- 4.1.3 Garage Walls, Ceiling, & Firewalls: Ceiling(s) Deteriorated Paint
- 4.1.4 Garage Walls, Ceiling, & Firewalls: Ceiling(s) Minor Damage
- ⚠ 4.1.5 Garage Walls, Ceiling, & Firewalls: Ceiling(s) Breach in Fire Barrier

- 4.5.1 Garage Slab Foundation: Slab Minor Cracking
- ₱ 5.2.1 Roof & Chimneys Flashings & Boots: Flashing(s) Maintenance Needed
- 5.3.1 Roof & Chimneys Chimneys & Vent Stacks: Chimney Maintenance Needed
- 5.4.1 Roof & Chimneys Gutters & Downspouts: Gutter(s) Maintenance Needed
- 6.1.1 Attic Attic Access: Attic Access Not Insulated
- 6.3.1 Attic Ventilation: Attic Vent(s) Missing / Out of Place Baffles
- 6.5.1 Attic Evidence of Leaks: Leaks Inaccessible
- ⊙ 7.2.1 HVAC & Fireplaces AC / Heat Pump Unit: Refrigerant Line Missing / Damaged Insulation
- ₹ 7.2.2 HVAC & Fireplaces AC / Heat Pump Unit: AC Unit Maintenance Needed
- 7.3.1 HVAC & Fireplaces Heating Unit: Furnace Maintenance Needed
- 7.3.2 HVAC & Fireplaces Heating Unit: Filter Dirty
- 7.4.1 HVAC & Fireplaces Ductwork: Ductwork Condensating
- 7.5.1 HVAC & Fireplaces Fireplace: Fireplace Dirty
- 8.2.1 Electrical Grounding / Bonding: Grounding Damaged / Loose Conduit
- 8.3.1 Electrical Main Distribution Panel(s): Panel Missing / Incomplete / Improper Labeling
- ▲ 8.3.3 Electrical Main Distribution Panel(s): Panel Gaps at Panel Cover

RHI Home Inspections Page 3 of 65

- 28.3.4 Electrical Main Distribution Panel(s): Panel Maintenance Needed
- 8.3.5 Electrical Main Distribution Panel(s): Panel Open / Improper Knockout(s)
- 8.3.6 Electrical Main Distribution Panel(s): Panel Double-Tapped Neutral(s)
- 8.3.7 Electrical Main Distribution Panel(s): Breaker(s) Mismatched
- 8.4.1 Electrical Branch Wiring: Wiring Exposed Wiring
- 8.4.2 Electrical Branch Wiring: Wiring Improperly Secured
- ▲ 8.5.2 Electrical Outlets: Outlet(s) Damaged / Worn / Obstructed
- ▲ 8.5.3 Electrical Outlets: GFCIs Missing
- 9.3.1 Plumbing Water Heater: Electric Disconnect Missing
- 9.4.1 Plumbing Supply Lines: Line(s) Corrosion Viewed
- ⊙ 9.6.1 Plumbing Sump Pump: Sump Pump Drained to Sanitary Sewer
- 2 10.2.1 Interior Walls: Wall(s) Deteriorated Paint / Wallpaper
- 2 10.4.1 Interior Doors: Door(s) Hardware Loose
- 10.5.2 Interior Floors: Carpet Stains
- 10.5.3 Interior Floors: Tile Missing / Deteriorated Grout
- 10.5.4 Interior Floors: Subfloor Uneven
- 11.2.1 Bathrooms Cabinets & Counters: Counter(s) Missing / Deteriorated Caulking
- 11.3.1 Bathrooms Sinks: Drain Line(s) Improper Repair
- 11.4.1 Bathrooms Toilets: Toilet Loose at Floor
- 11.5.1 Bathrooms Showers / Tubs: Surround Missing / Deteriorated Caulking
- 11.5.2 Bathrooms Showers / Tubs: Fixture Loose
- 11.5.3 Bathrooms Showers / Tubs: Fixture Improperly Sealed
- 12.2.1 Kitchen Sinks: Disposal Excessive Noise / Vibration
- 2 12.3.1 Kitchen Dishwasher: Dishwasher Missing High Loop
- 12.3.2 Kitchen Dishwasher: Dishwasher Improperly Draining
- △ 12.5.1 Kitchen Cooking Appliances & Ventilation: Appliance Anti-Tip Bracket Missing / Non-Functional
- 13.1.1 Laundry Cabinets & Counters: Cabinet(s) Improper Fasteners

- 🔗 14.3.1 Foundation Walls, Beams, & Columns: Foundation Wall(s) Efflorescence / Stains
- 14.3.2 Foundation Walls, Beams, & Columns: Foundation Wall(s) Moisture Intrusion
- 14.3.3 Foundation Walls, Beams, & Columns: Foundation Wall(s) Gaps to Exterior
- 14.4.1 Foundation Crawlspace: Vapor Barrier Debris
- 14.4.2 Foundation Crawlspace: Vapor Barrier Standing Water
- 14.4.3 Foundation Crawlspace: Vapor Barrier Multiple Layers
- 14.4.4 Foundation Crawlspace: Vapor Barrier Missing / Damaged / Improper
- 14.4.5 Foundation Crawlspace: Ground Muddy
- 14.6.1 Foundation Insulation: Insulation Missing / Out of Place

RHI Home Inspections Page 4 of 65

- 15.3.1 Environmental Fungal Growth: Suspected Fungal Growth Not Tested
- 15.3.2 Environmental Fungal Growth: Significant Fungal Growth Not Tested
- △ 16.1.1 Fire Safety Smoke Alarms: Smoke Alarm(s) Insufficient Number

RHI Home Inspections Page 5 of 65

1: INSPECTION DETAILS

Information

Type of Building

Detached, Single Family

Weather Conditions

Clear, Light Wind, Hot

General Life Expectancy Charts

Life Expectancies

Direction Structure Faces

West

Temperature

80-89

Electrical Service

Underground, East

Location and type of service entry for electricity to the structure.

2.01y 27 7022 11:39 AM

Precipitation Within Last Three Days?

Rain

In Attendance

Inspector(s)

Occupancy

Vacant

If a property is furnished or has stored belongings, then access to some items such as electrical outlets, windows, wall/floor surfaces, and cabinet interiors will be restricted. It is likely that some deficiencies may be become evident once the house is empty.

RHI Home Inspections Page 6 of 65

Elevation Photos

Photos of around the structure at the time of inspection.











Water Meter / Well Head Location

Public, Yard Near Street

Listed here is the source and location of the water meter or well head if known and located at the time of inspection.



Exterior Drainage Clean-out

East


These are recommended in the event a sewer line problem occurs or a person needs access to the sewer lateral. A clean-out should be readily accessible at the building exterior and every 100' after until sewer lateral reaches city main or septic tank.



RHI Home Inspections Page 7 of 65

Interior Photos

Photos of the property are taken in order, starting on the uppermost floor of the building and rotating in a counterclockwise fashion around each floor, from top to bottom.

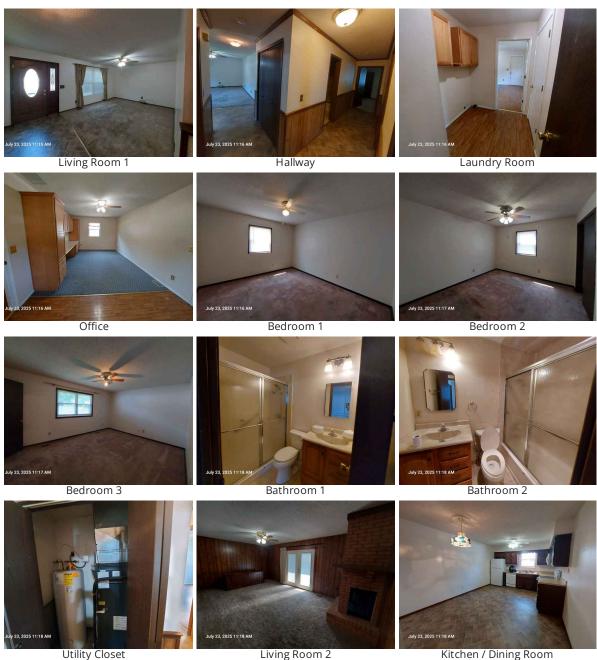

Limitations

Reference Photos & General Limitations

FINISHED INTERIOR

Interior of structure was noted as finished at the time of the inspection. This means that wall coverings block framing, electrical wiring, plumbing, and other hidden systems from view.

RHI Home Inspections Page 8 of 65

Reference Photos & General Limitations

DETACHED BUILDING(S) PRESENT

Detached building(s) was / were present at the time of inspection. These systems are outside the scope of a standard home inspection. RHI can perform this service for an additional fee.



Reference Photos & General Limitations

FENCE PRESENT

A fence was present at the time of inspection. These systems are outside the scope of a standard home inspection unless a pool is present.

RHI Home Inspections Page 9 of 65

2: FXTFRIOR

Information

Siding: Siding Material

Vinyl, Brick

Fascia, Soffit, Trim, & Columns: Wood Materials

Wood or wood-like materials present. These materials are subject to moisture damage and weathering to a greater extent than other materials, as well as infestation by wood-destroying organisms. These materials require regular maintenance and upkeep to prevent premature damage and deterioration.

Fascia, Soffit, Trim, & Columns: Moisture Stains

Moisture stains were noted on soffits at one or more locations at the time of inspection. This indicates the presence of moisture, whether previous or active the inspector could not determine. Recommend monitoring soffits & further evaluation if condition worsens.



Windows: No Significant Defects Observed

Windows were inspected for damage, proper drainage, functional seals, etc. Please note it is common for painters to cover up rotted wood, sometimes making it difficult to identify at the time of inspection. No reportable deficiencies were present at the time of inspection unless otherwise noted in this report.

Exterior Doors: No Significant Defects Observed

All exterior doors were inspected by looking for damage, lack of proper flashing, deficiencies with their operation, missing weatherstripping, etc. No reportable deficiencies were present at the time of inspection unless otherwise noted in this report.

Observations

2.1.1 Siding



SIDING - MAINTENANCE NEEDED

Regular maintenance is required to keep property in good condition, which includes but is not limited to cleaning, caulking, sealing & painting. Recommend surfaces be washed & properly cleaned, gaps or holes be filled, & exposed surfaces, weathering, or peeling paint properly prepped & sealed or repainted as needed.

Recommendation

Contact a qualified professional.

RHI Home Inspections Page 10 of 65

2.1.2 Siding

SIDING - MINOR DAMAGE



Minor damage to siding was noted at one or more locations at the time of inspection. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified siding specialist.



2.2.1 Fascia, Soffit, Trim, & Columns



TRIM - MAINTENANCE NEEDED

Regular maintenance is required to keep property in good condition, which includes but is not limited to cleaning, caulking, sealing & painting. Recommend surfaces be washed & properly cleaned, gaps or holes be filled, & exposed surfaces, weathering, or peeling paint properly prepped & sealed or repainted as needed.

Recommendation

Contact a qualified professional.



2.2.2 Fascia, Soffit, Trim, & Columns

VENT COVER(S) - IMPROPER CLEARANCE



One or more vent covers were noted as having improper clearance at the time of inspection. Vents should terminate at minimum 12 inches from ground level. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified handyman.



2.2.3 Fascia, Soffit, Trim, & Columns

Deficiencies

VENT COVER(S) - LOOSE / UNSEALED

One or more exterior vent covers were noted as loose or unsealed at the time of inspection. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified professional.



2.3.1 Windows

WINDOW(S) - MAINTENANCE NEEDED



RHI Home Inspections Page 11 of 65

Regular maintenance is required to keep property in good condition, which includes but is not limited to cleaning, caulking, sealing & painting. Recommend surfaces be washed & properly cleaned, gaps or holes be filled, & exposed surfaces, weathering, or peeling paint properly prepped & sealed or repainted as needed.

Recommendation

Contact a qualified professional.

2.4.1 Exterior Doors

Maintenance / Recommendations

DOOR(S) - MAINTENANCE NEEDED

Regular maintenance is required to keep property in good condition, which includes but is not limited to cleaning, caulking, sealing & painting. Recommend surfaces be washed & properly cleaned, gaps or holes be filled, & exposed surfaces, weathering, or peeling paint properly prepped & sealed or repainted as needed.

Recommendation

Contact a qualified professional.



RHI Home Inspections Page 12 of 65

3: GROUNDS

Information

Driveways, Walkways & Patios: Driveway, Walkway, & Patio

Material

Concrete, Pavers

Porches: Porch Material
Concrete

Stairs, Ramps, & Railings: Stair / Railing Types Concrete

Fencing: Fence Material

Metal, Plastic

Driveways, Walkways & Patios: Concrete / Asphalt Cracking

Concrete or asphalt surfaces were noted at the time of inspection, which often crack over time. This could be due to a variety of conditions, such as cracking during a curing process, weather, improper fill under surface, etc. Recommend proper maintenance of paved surfaces through regular sealing & water management.

Grading / Drainage: Lot Grading

Lot grading & drainage have a significant impact on the building(s) due to the direct & indirect damage that moisture can have on the foundation. Due to this, it is critical that surface runoff water be adequately diverted away from the building(s). Lot grading should slope away from building(s) a minimum of one inch for every foot of slope for at least 6 feet around the perimeter of the building(s).

Vegetation: No Significant Defects Observed

There were no areas visible where vegetation was negatively impacting the structure at the time of inspection.

Porches: No Significant Defects Observed

Steps & porches were inspected for damage, settlement, etc. No reportable defects were viewed at the time of inspection.

Stairs, Ramps, & Railings: No Significant Defects Observed

The stairs were inspected by evaluating the risers and treads, applicable railings, etc. No deficiencies were present at the time of inspection unless otherwise noted in this report.

Fencing: No Significant Defects Observed

Fences and gates are outside the Standards of Practice for home inspectors but we will typically look for any obvious damage on fences/gates close to the house.

Limitations

Fencing

OUTSIDE OF SCOPE

Fences and gates are considered outside the Standards of Practice for home inspectors (except when a pool is present).

Fencing

PROPERTY LINES

RHI Home Inspections Page 13 of 65

Fencing between property lines were noted on by the inspector. The inspector is not informed on property lines.

Observations

3.1.1 Driveways, Walkways & Patios



DRIVEWAY - MINOR CRACKING

Minor cracks were noted on driveway surfaces at the time of inspection. These do not appear to be negatively impacting the function of the driveway. Recommend sealing the cracks to prolong the life of the driveway.

Recommendation

Contact a qualified handyman.



3.1.2 Driveways, Walkways & Patios



WALKWAY(S) - MINOR CRACKING

Minor cracks were noted on walkway surfaces at the time of inspection. These do not appear to be negatively impacting the function of the walkway. Recommend sealing the cracks to prolong the life of the walkway.

Recommendation

Contact a qualified handyman.



3.1.3 Driveways, Walkways & Patios



PATIO(S) - MINOR CRACKING

Minor cracks were noted on patio surfaces at the time of inspection. These do not appear to be negatively impacting the function of the patio. Recommend sealing the cracks to prolong the life of the patio.

Recommendation

Contact a qualified handyman.



3.1.4 Driveways, Walkways & Patios

CONCRETE - MISSING / DETERIORATING EXPANSION FILLER



MULTIPLE LOCATIONS

Expansion gap filler was noted as missing or deteriorated in one or more locations at the time of inspection. This expansion filler is used to help prevent moisture from making its way under concrete and near the structure. Recommend further evaluation & correction by qualified contractor.

Recommendation

Contact a qualified professional.

RHI Home Inspections Page 14 of 65



3.2.1 Grading / Drainage



GRADING - SIDING CONTACT

Soil or landscaping material covering the siding was noted at the time of inspection. There should be 4-6" of clearance between the bottom of the siding and the ground to prevent moisture damage and pest intrusion. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified grading contractor.



RHI Home Inspections Page 15 of 65

4: GARAGE

Information

Walls, Ceiling, & Firewalls: Wall Type

Drywall

Fire Door(s): Door Type

Steel

Walls, Ceiling, & Firewalls: Ceiling Windows: Window Type(s)

TypeDrywall

Garage Doors & Openers: Door Type

1, 9' Opening, Sectional, Steel, Insulated

Garage Doors & Openers: Opener

Type

Automatic, Chain-Drive

Vinyl, Double Hung

Slab Foundation: Slab Type

Concrete

Garage Photos

Photos taken of the garage to show its condition during the home inspection.



Walls, Ceiling, & Firewalls: Fire Barrier Information

Garages attached to a dwelling should be separated by proper fire protection barriers. Walls between garage and living space should be not less than 1/2" drywall or equivalent, with properly taped or sealed joints. If the ceiling is of fire rated material, the wall coverings should extend the full height. Ceilings beneath a living space should be not less than 5/8" type X drywall or equivalent, otherwise ceilings should follow same standards as walls. All openings, such as doors, attic accesses, etc., shall be a properly fire rated door or hatch, preferably with self closing & latching features to prevent doors accidentally being left open to the garage. Ductwork exposed to garage shall be no less than 26-gauge steel sheet with no openings in the garage. While some older homes do not abide by these standards, they are designed to ensure present and active safety hazards are identified and can be corrected.

Windows: No Significant Defects Observed

The windows were inspected by operating a representative number (we will try and operate all accessible windows in the home, but personal belongings often block access to some). Operation was tested, along with looking for damage, broken glass, failed seals, etc. (Please note that "fogged windows" due to failed seals can become evident only during certain lighting/weather conditions. Dirty windows also make it very difficult to identify failed seals.) No reportable deficiencies were present unless otherwise noted in this report.

RHI Home Inspections Page 16 of 65

Fire Door(s): Fire Barrier Information

Garages attached to a dwelling should be separated by proper fire protection barriers. Walls between garage and living space should be not less than 1/2" drywall or equivalent, with properly taped or sealed joints. If the ceiling is of fire rated material, the wall coverings should extend the full height. Ceilings beneath a living space should be not less than 5/8" type X drywall or equivalent, otherwise ceilings should follow same standards as walls. All openings, such as doors, attic accesses, etc., shall be a properly fire rated door or hatch, preferably with self closing & latching features to prevent doors accidentally being left open to the garage. Ductwork exposed to garage shall be no less than 26-gauge steel sheet with no openings in the garage. While some older homes do not abide by these standards, they are designed to ensure present and active safety hazards are identified and can be corrected.

Fire Door(s): No Significant Defects Observed

Walls, ceilings, and fire separation between garage and living space were inspected for damage or safety concerns. At the time of inspection, no reportable conditions were present at visible portions unless otherwise noted in this report.

Slab Foundation: Slab Cracking

All concrete floor slabs experience some degree of cracking due to shrinkage in the drying process. In most instances floor coverings prevent recognition of cracks or settlement in all but the most severe cases. Where carpeting and other floor coverings are installed, the materials and condition of the flooring underneath cannot be determined.

Slab Foundation: No Significant Defects Observed

Slab Foundation was inspected, where visible, for evident damage or improper installation. The slab appeared to be fulfilling its intended function at the time of inspection.

Evidence of Leaks: No Leaks Observed

Accessible/visible portions of the garage were inspected for evidence of current or past leaks. No leaks were visible at the time of inspection.

Evidence of Leaks: Inclement Weather

The weather conditions at the time of inspection can affect the discoveries of an inspection. Unusually dry or rainy weather will influence what the inspector is able to find.

Limitations

Slab Foundation

BELONGINGS

Viewing of some foundation slab was blocked by personal belongings at the time of inspection.

Slab Foundation

MINOR VARIATIONS

Concrete slab foundations are commonly slightly uneven or found to have minor variations across the surface, however due to floor coverings these conditions are commonly not visible.

Observations

4.1.1 Walls, Ceiling, & Firewalls





RHI Home Inspections Page 17 of 65

Wall paint was noted as deteriorated at the time of inspection. This deterioration can appear as blistering, cracking, peeling, or any other surface blemish. Recommend further evaluation & correction by a qualified contractor.

Here is a DIY article on treating cracking paint.

Recommendation

Contact a qualified painting contractor.



4.1.2 Walls, Ceiling, & Firewalls

WALL(S) - MINOR DAMAGE



Minor damage was noted on one or more walls, such as dings, scuffs, or hairline cracks, at the time of inspection. Damage appeared to be cosmetic and not of significant impact to wall coverings. Recommend monitoring for further degradation.

Recommendation

Contact a qualified professional.



4.1.3 Walls, Ceiling, & Firewalls

CEILING(S) DETERIORATED PAINT



Ceiling paint was noted as deteriorated at the time of inspection. This deterioration can appear as blistering, cracking, peeling, or any other surface blemish. Recommend further evaluation & correction by a qualified contractor.

Here is a DIY article on treating cracking paint.

Recommendation

Contact a qualified painting contractor.



4.1.4 Walls, Ceiling, & Firewalls

CEILING(S) - MINOR DAMAGE



Minor damage was noted on interior ceiling(s) at the time of inspection. This Damage, such as nail pops, cracking tape seams, etc, appeared to be cosmetic and not of significant impact to ceiling coverings. Recommend monitoring for further degradation.

Recommendation

Recommend monitoring.



4.1.5 Walls, Ceiling, & Firewalls

CEILING(S) - BREACH IN FIRE BARRIER

Structural / Safety Hazard

RHI Home Inspections Page 18 of 65

Openings or gaps were noted in the ceilings between the garage and living space at the time of inspection. This creates a safety concern due to the lack of complete fire protection. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified professional.



4.2.1 Windows

WINDOW(S) - MAINTENANCE NEEDED



Windows noted in need of maintenance at the time of inspection. Recommend caulking, freeing, cleaning, stripping, and painting windows as needed.

Recommendation

Contact a handyman or DIY project

4.4.1 Garage Doors & Openers



GARAGE DOOR - MAINTENANCE NEEDED

Regular maintenance was noted as needed at the time of inspection. This is to keep property in good condition, which includes but is not limited to cleaning, caulking, sealing & painting. Recommend surfaces be washed & properly cleaned, gaps or holes be filled, & exposed surfaces, weathering, or peeling paint properly prepped & sealed or repainted as needed.

Recommendation

Contact a qualified garage door contractor.

4.5.1 Slab Foundation

Maintenance / Recommendations

SLAB - MINOR CRACKING

Minor cracks less than 1/4" wide were noted on the foundation slab at the time of inspection. This type of cracking is common on most slabs and did not appear to be a cause for concern at the time of inspection. Recommend sealing to prevent water infiltration and monitoring for further deterioration.

Recommendation

Contact a handyman or DIY project



RHI Home Inspections Page 19 of 65

5: ROOF & CHIMNEYS

Information

Roof Coverings: Inspection Method Climbed/Walked **Roof Coverings: Materials**Architectural Asphalt Shingles

Chimneys & Vent Stacks: Type of Chimney Factory Built



Roof Coverings: General Photo(s)









Roof Coverings: Estimated Age of Roof

Roof appeared to be in the middle third of service life

General estimates regarding the age of the roof are subjective and are intended to give our client an approximate idea of remaining service life.

RHI Home Inspections Page 20 of 65

Roof Coverings: Minor Granule Loss

Roof coverings were noted as having limited areas of granule loss at the time of inspection. Some granule loss is a normal and expected part of the aging process of asphalt roofing. The roof was still fulfilling their intended function at the time of inspection. Recommend monitoring.



Chimneys & Vent Stacks: Level II Inspection Recommended

The National Fire Protection Association (www.nfpa.org) advises that each chimney receive a Level II inspection each time a residence is sold. This type of inspection is beyond the scope of our inspection and involves running a camera down the flue to inspect for defects. It is also advised that this inspection be conducted by a chimney sweep certified by the Chimney Safety Institute of America (www.csia.org).

Chimneys & Vent Stacks: Chimney Scope Recommended

Chimney flue interior is beyond the scope of a standard residential inspection. Recommend having chimney flue evaluated by use of a camera. RHI can perform this service. More Info

Chimneys & Vent Stacks: No Significant Defects Observed

The chimney and/or vent stacks were viewed from ground level, a ladder, on the roof, or by drone. This is a limited inspection of the chimney - we do not remove chimney caps. Further evaluation of chimneys by a certified chimney sweep is always recommended. At the time of inspection, no reportable conditions were present at visible portions unless otherwise noted in this report.

Limitations

Flashings & Boots

LIMITED VISIBILITY

Inspector had limited visibility to boot(s) and flashing at the time of inspection.

Gutters & Downspouts

UNDERGROUND DRAINAGE PIPE(S)

One or more underground drains were viewed. These pipes typically require regular maintenance and testing them is outside the scope of this inspection.

Gutters & Downspouts

GUTTER GUARDS

Gutter guards were noted as being installed at the time of the inspection. These can limit the inspection of the gutter system.

RHI Home Inspections Page 21 of 65

Observations

5.2.1 Flashings & Boots

Maintenance / Recommendations

FLASHING(S) - MAINTENANCE NEEDED

Roof flashing(s) noted showing signs of deterioration at the time of the inspection. All visible flashing appeared to be in serviceable condition, but should be maintained in good condition. Recommend resealing.

Repaired by contractor

Recommendation

Contact a qualified handyman.



5.3.1 Chimneys & Vent Stacks

CHIMNEY - MAINTENANCE NEEDED



Chimney was noted as rusted, weathered, or in need of maintenance at the time of the inspection. Recommend having the chimney maintenanced by cleaning, repainting, or resealing the chimney.

Recommendation Repaired by contractor

Contact a qualified handyman.

5.4.1 Gutters & Downspouts



GUTTER(S) - MAINTENANCE NEEDED

Gutters require regular maintenance including caulking, painting, and cleaning. Recommend that any unsealed joints be caulked and gutters be repainted or cleaned as needed.

Recommendation

Contact a qualified handyman.

RHI Home Inspections Page 22 of 65

6: ATTIC

Information

Attic Access: Type

Pulldown Ladder, Ceiling Scuttle

, 0

Insulation: Insulation Type

Loose Fill, Fiberglass

Roof Structure: Type

Engineered Trusses, Plywood

Decking

Insulation: Approx. Depth

12"-14"

Ventilation: Ventilation TypeSoffit Vents, Thermostatically
Controlled Fan, Fixed-Field Vents





Attic Access: Location(s)
Garage, Bedroom, Closet





RHI Home Inspections Page 23 of 65

Roof Structure: Previous Repairs Observed

Previous repairs were noted at the time of the inspection. The inspector cannot guarantee the function or longevity of any repairs, and if any concerns are present recommend further evaluation by a qualified contractor.



Roof Structure: No Significant Defects Observed

The roof structure was inspected at visible/accessible portions looking for any signs of moisture infiltration, damage, or other deficiencies. No reportable conditions were observed at the time of inspection unless otherwise noted in this report.

Insulation: No Significant Defects Observed

The insulation was inspected to determine the approximate depth and type. Current standards recommend approximately 10 inches of loose fill fiberglass or 6 inches of cellulose insulation to achieve an R-30 rating. Depending on when the home was constructed anywhere from 6-14 inches may be present. No reportable deficiencies were observed with the insulation unless otherwise noted in this report.

Evidence of Leaks: Inclement Weather

The weather conditions at the time of inspection can affect the discoveries of an inspection. Unusually dry or rainy weather will influence what the inspector is able to find.

Limitations

Roof Structure

INSULATION

Inspection of attic structure was limited due to insulation in one or more attic areas at the time of the inspection.

Ventilation

THERMOSTATIC CONTROLLED VENT FAN(S)

Thermostatic controls for powered vent fan(s) were either inaccessible or it was too cold to activate power. Vent fans were not tested.

Insulation

CAN LIGHTS

Inspector was unable to determine if the can lights present in the home were rated to be in contact with insulation.

RHI Home Inspections Page 24 of 65

Evidence of Leaks

EXTENT OF DAMAGE

Inspector is unable to determine extent of any damage caused by leaks noted in the report. We recommend having a qualified contractor determine the cause and extent of the damage from noted areas.

Observations

6.1.1 Attic Access



ATTIC ACCESS - NOT INSULATED

Attic access was noted as not insulated at the time of inspection. This can cause energy loss. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified insulation contractor.



6.3.1 Ventilation

ATTIC VENT(S) - MISSING / OUT OF PLACE



Soffit vent baffles were noted as missing or out of place at the time of inspection. This condition can cause drafting of insulation or allow insulation to suffocate soffit vents. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified professional.

 


Maintenance / Recommendations

6.4.1 Insulation

INSULATION - DISTURBED

MULTIPLE LOCATIONS



Recommendation

Contact a qualified insulation contractor.

RHI Home Inspections Page 25 of 65



6.5.1 Evidence of Leaks

LEAKS - INACCESSIBLE



Evidence of leaking was viewed at the time of inspection. The stains were not readily accessible to test with a moisture meter and the inspector was unable to determine how long ago they occurred. Recommend further evaluation & correction by a qualified contractor.

Corrected by contractor

Recommendation

Contact a qualified professional.



Above Garage

RHI Home Inspections Page 26 of 65

7: HVAC & FIREPLACES

Information

Thermostats: LocationHallway



AC / Heat Pump Unit: Manufacturer Goodman

Heating Unit: Location

Thermostats: No Significant Defects Observed

Thermostat(s) appeared to operate normally.

AC / Heat Pump Unit: Manufacture Date 2016



Heating Unit: ManufacturerGoodman

AC / Heat Pump Unit: Location North



AC / Heat Pump Unit: HVAC & Water Heater Database

HVAC/Water Heater

Heating Unit: Manufacture Date 2016





RHI Home Inspections Page 27 of 65

Heating Unit: Energy Source Appliance in operation Heat Pump

Heating Unit: Filter LocationAbove Unit, Cut into Ductwork



Heating Unit: Filter Size 20, x20, x4

Heating Unit: HVAC & Water Heater Database

HVAC/Water Heater

Ductwork: Ductwork TypeRigid, Flex, Insulated





Fireplace: Type


Prefabricated Wood Burning Fireplace

AC / Heat Pump Unit: Cooling Information

Appliance in operation

An infrared camera was used to show the system responded to normal operating controls, at the time of inspection. These images are not intended to show the exact temperature differential produced or the efficiency of the system; which lies beyond the scope of a home inspection. HVAC thermometers (wet bulb) are required for accurate readings, and measurement points would be carried out at a different location by an HVAC contractor. Typical temperature differentials between return and supply air is 14 - 20 degrees in cooling mode. Several factors can affect these numbers, such as, but not limited to: indoor ambient air temperature, exterior ambient air temperature, humidity, cleanliness of the air filter and evaporator, etc. Heat pump setting was



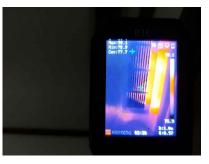

Fireplace: Level II Inspection

The National Fire Protection Association (www.nfpa.org) advises that all chimneys for wood burning fireplaces receive a Level II inspection each time a residence is sold. This type of inspection involves running a camera down the flue to inspect for defects. It is also advised that this inspection be conducted by a chimney sweep certified by the Chimney Safety Institute of America (www.csia.org).

Limitations

RHI Home Inspections Page 28 of 65

Heating Unit

HEAT PUMP NOT TESTED

Heat pump unit(s) were not tested due to high outdoor temperature at the time of inspection. Running the heat pump during hot weather can damage the unit. Recommend further evaluation by a licensed HVAC technician.

Ductwork

INSULATION COVER

Ductwork was fully or partially covered by insulation at the time of inspection, limiting view.

Observations

7.2.1 AC / Heat Pump Unit

REFRIGERANT LINE - MISSING / DAMAGED INSULATION



MULTIPLE LOCATIONS

Missing or damaged insulation was noted on the refrigerant/suction line at the time of inspection. This can cause moisture to drip off the line and cause moisture stains on ceilings or other areas of the house. It should be one continuous run from each appliance. Recommend further evaluation & correction by a qualified contractor.

Corrected by contractor

Recommendation

Contact a qualified HVAC professional.







7.2.2 AC / Heat Pump Unit

AC UNIT - MAINTENANCE NEEDED



AC unit noted as an aging unit, dirty, or some other condition was present at the time of the inspection. Recommend yearly maintenance be conducted to ensure full life expectancy of unit can be reached.

Recommendation Under 2x yearly service contract with Ray's Heat and A/C Contact a qualified HVAC professional.

7.3.1 Heating Unit

Maintenance / Recommendations

FURNACE - MAINTENANCE NEEDED

Furnace noted as an aging unit, dirty, or some other condition was present at the time of the inspection. Recommend yearly maintenance be conducted to ensure full life expectancy of furnace can be reached.

Recommendation

Contact a qualified HVAC professional.

7.3.2 Heating Unit

Maintenance / Recommendations

FILTER - DIRTY

The furnace filter noted as dirty at the time of inspection. Recommend that you check and change the filter per the manufacture requirements.

Recommendation Replaced

Recommended DIY Project



7.4.1 Ductwork

DUCTWORK - CONDENSATING



Ductwork noted as condensating at one or more locations at the time of inspection. This condition will contribute to elevated moisture levels in areas that it occurs. Recommend further evaluation & correction by a qualified contractor. Repaired by contractor

Recommendation

Contact a qualified HVAC professional.



7.5.1 Fireplace

FIREPLACE - DIRTY



Creosote build up was noted in the fireplace and/or the chimney flue at the time of inspection. Recommend cleaning by a professional chimney sweep.

Recommendation

Contact a qualified chimney sweep.



RHI Home Inspections Page 30 of 65

8: ELECTRICAL

Information

Electrical Service: Service Voltage Grounding / Bonding: Type / 240V

Location

Ground rod(s) at exterior, Bonding Screw at Main Panel Main Distribution Panel(s): Main **Panel Location** Bedroom, Closet



Type

Circuit Breaker

Main Distribution Panel(s): Panel Main Distribution Panel(s): Panel Capacity

200 AMP

Main Distribution Panel(s): Manufacturer General Electric





Main Distribution Panel(s): **Service Conductors** Aluminum Multi-Strand

Branch Wiring: Wiring Method Copper non-metalic sheathed cable

Light Fixtures, Switches & Fans: Lighting Types Fixtures, Ceiling Fan, Recessed, Chandelier

Electrical Service : No Significant Defects Observed

Power was supplied to the home via service conductors. The meter and protective conduit appeared to be in satisfactory condition. No deficiencies were observed at visible portions unless otherwise noted in this report.

RHI Home Inspections Page 31 of 65

Grounding / Bonding: No Significant Defects Observed

Grounding was inspecting to ensure proper connection to ground, as well as all applicable appliances or panels are properly grounded. No notable defects were observed unless otherwise noted in the report.

Main Distribution Panel(s): Breaker(s) Off / Fuse(s) Blown

U

Any breakers that are off will not be turned on by the inspector. Recommend inquiry with current owner or further evaluation by qualified contractor for the reason these breakers are off.

Outlets: GFCI Reset Locations

Main Panel(s)

GFCIs are required in any area that contains a water source or is considered unfinished. GFCIs may also be seen in interiors that were updated from 2 prong non-grounded outlets to 3 prong non-grounded outlets. These found in areas that are finished without water serve to protect people. These outlets may not always reset in the area they are tripped. Multiple areas may be protected by a single GFCI outlet or breaker.



Light Fixtures, Switches & Fans: No Significant Defects Observed

Switches and lights were tested throughout the home and were found to be in good working order. No deficiencies were observed unless otherwise noted in this report. Exterior dusk to dawn lights, motion lights, landscape lighting, or any light not attached to the structure are not included in a home inspection, and were not tested for functionality. These items are excluded from this inspection.

Limitations

Electrical Service

UNDERGROUND SERVICE

House was equipped with an underground service at the time of inspection. Any components hidden in the ground are not visible and therefore outside of the scope of inspection.

Outlets

220V/240V NOT TESTED

220V/240V receptacles are not tested for functionality or polarity, as they can not be tested with a standard receptacle polarity tester. Only visual deficiencies will be reported on with relation to these receptacle(s).

Observations

8.2.1 Grounding / Bonding

GROUNDING - DAMAGED / LOOSE CONDUIT



RHI Home Inspections Page 32 of 65

Conduit in place covering the ground wire was noted as damaged or loose at the time of inspection. This is not a safety concern as ground wires do not require any type of protection. Recommend monitoring.

Recommendation

Recommend monitoring.



8.3.1 Main Distribution Panel(s)



PANEL - MISSING / **INCOMPLETE / IMPROPER LABELING**

Panel noted not have clear/complete labeling at the time of inspection. All fuse or breaker panels are required to have an accurate listing of what the circuits are connected to. An unsafe condition can exist if the homeowner turns off a breaker, believing to have killed the power on the circuit, only to find that they tripped the wrong breaker. Additionally, the inspector is not able to determine if breakers are properly sized for appliances if the panel is not labeled. Recommend further evaluation & correction by a qualified contractor. Repaired by contractor

 


Recommendation

Contact a qualified electrical contractor.

8.3.2 Main Distribution Panel(s)

PANEL - MISSING SCREW(S)



Recommendation

Repaired by contractor Contact a handyman or DIY project

8.3.3 Main Distribution Panel(s)



One or more gaps were noted around the panel cover at the time of inspection. Recommend further evaluation & correction by a qualified contractor. Repaired by contractor

Recommendation

Contact a qualified electrical contractor.



Maintenance / Recommendations

8.3.4 Main Distribution Panel(s)

PANEL - MAINTENANCE NEEDED

Maintenance / Recommendations

RHI Home Inspections Page 33 of 65

Excessive dust, dirt or debris was noted inside the electric panel at the time of inspection. This can cause an arc flash in the panel. An arc flash occurs when a flash over of electric current leaves its intended path and travels through the air from one conductor to another, or to neutral or ground. An arc flash can cause a serious electrical burn. Recommend further evaluation & correction by a qualified contractor.

Recommendation

 
Contact a qualified electrical contractor.

Repaired by contractor



8.3.5 Main Distribution Panel(s)

PANEL - OPEN / IMPROPER KNOCKOUT(S



Recommendation

 
Contact a qualified electrical contractor.

Repaired by contractor



8.3.6 Main Distribution Panel(s)

PANEL - DOUBLE-TAPPED NEUTRAL(S)




Recommendation

Contact a qualified electrical contractor. Repaired by contractor



8.3.7 Main Distribution Panel(s)

 BREAKER(S) - MISMATCHED



Recommendation

Contact a qualified electrical contractor.

Repaired by contractor



RHI Home Inspections Page 34 of 65

8.4.1 Branch Wiring

WIRING - EXPOSED WIRING



MULTIPLE LOCATIONS

Unprotected electrical wiring was noted at one or more locations at the time of inspection. Wiring in storage or living areas should be protected in conduit to keep it from being damaged. Wiring on the exterior of home should be rated for exterior exposure or protected by exterior rated conduit. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Repaired

Contact a qualified electrical contractor.





Utility Room

Kitchen

8.4.2 Branch Wiring

WIRING - IMPROPERLY SECURED



Improperly secured electrical wiring was noted in one or more areas at the time of inspection. All electrical wiring should be properly secured to framing members to protect it from damage. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified electrical contractor.

Repaired



Crawlspace

8.5.1 Outlets

OUTLET(S) - LOOSE

MULTIPLE LOCATIONS

Loose receptacles were noted at one or more locations at the time of inspection. Recommend tightening outlets as needed.

Recommendation

Repaired

Contact a qualified electrical contractor.

Maintenance / Recommendations

RHI Home Inspections Page 35 of 65





8.5.2 Outlets

OUTLET(S) - DAMAGED / WORN / OBSTRUCTED



MULTIPLE LOCATIONS

One or more damaged, worn, obstructed outlet(s) were noted at the time of inspection. Damaged or worn outlets can result in arcing and a potential fire when an electronic device or appliance is plugged into the outlet, making this a safety hazard. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified electrical contractor.







8.5.3 Outlets

GFCIS - MISSING

MULTIPLE LOCATIONS



Ground Fault Circuit Interrupter (GFCI) protected receptacles were noted as not installed in some areas where they are required at the time of inspection. While GFCI protection may not have been required by code when the house was built, this is now considered a safety hazard. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Installed

Contact a qualified electrical contractor.

RHI Home Inspections Page 36 of 65





Garage Multiple Locations

Kitchen Multiple Locations

RHI Home Inspections Page 37 of 65

9: PLUMBING

Information

Service: Location of Shut Off Valve

By the Water Heater, Utility Room



Service: Service Line Material Copper

Water Heater: Location Hallway, Utility Room



Water Heater: Manufacturer General Electric

Water Heater: Manufacture Date Water Heater: Capacity 2003

50 Gallon

Water Heater: Power Source Appliance in operation Electric



Water Heater: HVAC & Water **Heater Database**

Water Heater Database A-Z

Supply Lines: Material Copper

Page 38 of 65 RHI Home Inspections

Drain, Waste, & Vent Systems: Material

PVC, ABS

Sump Pump: General Photo(s)



Service: No Significant Defects Observed

Visible portions of the water service line were inspected for leaks and damage. Water pressure was tested and found to be within the acceptable range of 40-80 psi.

Hose Bibs / Spigots: No Significant Defects Observed

Visible portions of the water spigot(s) were inspected for damage and/or leaks. No reportable defects were viewed at the time of the inspection unless otherwise noted in this report.

Water Heater: Nearing End of Expected Service Life

Water heater typical life expectancy is between 9 -12 years. While the unit was operable at the time of the inspection, we cannot project how much longer it will continue to provide adequate hot water. Recommend budgeting for replacement.

Water Heater: Strapping

Strapping was noted as missing at the time of inspection. Strapping is recommended on the top and bottom 1/3 of the tank in the event of seismic activity.

Water Heater: TPR Valve Drains Inside

The TPR (temperature and pressure relief) valve did not drain into an open drain at the time of inspection. In the event of a discharge this may cause moisture damage to flooring and building materials.

Water Heater: Leak Pan None Present

No leak pan was installed under the water heater. While building codes do not require a leak pan if the water heater is located in a unfinished area, they are recommend as damage to flooring / belongings in adjacent areas may occur if the water heater leaks.

Supply Lines: No Significant Defects Observed

Visible portions of the water distribution pipes were inspected looking for leaks or other significant deficiencies. No reportable conditions were visually present at the time of inspection unless otherwise noted in this report.

Drain, Waste, & Vent Systems: Sewer Scope Recommended

We recommend having the sewer line inspected. This separate inspection will show the condition of the buried sewer line from the structure to the city main or septic. Items such as tree roots, broken drain pipes, and other obstructions will be revealed. Property owners are responsible for the line up to the attachment to the city main. RHI can also perform this service. https://yourrhi.com/sewer-scope-inspections/

Drain, Waste, & Vent Systems: No Significant Defects Observed

Visible portions of the (DWV) drain, waste, and vent pipes were inspected looking for leaks or indications of other significant deficiencies. No leaks or other reportable conditions were visibly present unless otherwise noted in this report. Sewer camera inspections are recommended for any structure regardless of age due to the sewer lateral between the structure and sewer service or structure and septic tank not being visible and the possibility of damage, blockages, or sagging areas in this pipe.

Observations

RHI Home Inspections Page 39 of 65

Maintenance / Recommendations

9.3.1 Water Heater

ELECTRIC - DISCONNECT MISSING



There was no electrical disconnect within sight of the electric water heater at the time of inspection. Electric appliances are required to have a disconnect within sight of the appliance. Recommend further evaluation & correction by a qualified contractor.

Repaired Recommendation

Contact a qualified electrical contractor.



9.4.1 Supply Lines

LINE(S) - CORROSION

VIEWED

Corrosion was noted on supply line(s) at the time of the inspection. No leaks found at the time of inspection. Recommend monitoring.

Repaired Recommendation

Recommend monitoring.



9.6.1 Sump Pump

SUMP PUMP - DRAINED TO SANITARY SEWER



Sump pump noted to appear to drain to sanitary sewer at the time of the inspection. Sumps should never drain to the sanitary sewer; they should always be routed to a storm drainage system. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified plumbing contractor.



Inspected by licensed plumber; determined to be properly installed

RHI Home Inspections Page 40 of 65

10: INTERIOR

Information

Ceilings: Ceiling TypeWalls: Wall TypeWindows: Window Type(s)DrywallDrywall, PanelingVinyl, Double Hung

Doors: Door Types Floors: Type Stairs, Ramps, & Railings: Stair

Hollow Core, Hinged, Folding Floating, Carpet, Sheet Vinyl, Tile **Types**Garage

Walls: No Significant Defects Observed

Visible portions of the interior walls were inspected looking for signs of moisture infiltration, settlement cracking, significant damage, or other significant deficiencies. No reportable deficiencies were observed at the time of inspection unless otherwise noted in this report.

Windows: No Significant Defects Observed

The windows were inspected by operating a representative number (we will try and operate all accessible windows in the home, but personal belongings often block access to some). Operation was tested, along with looking for damage, broken glass, failed seals, etc. (Please note that "fogged windows" due to failed seals can become evident only during certain lighting/weather conditions. Dirty windows also make it very difficult to identify failed seals.) No reportable deficiencies were present unless otherwise noted in this report.

Stairs, Ramps, & Railings: No Significant Defects Observed

The stairs were inspected by evaluating the risers and treads, applicable railings, etc. No deficiencies were present at the time of inspection unless otherwise noted in this report.

Evidence of Leaks: Inclement Weather

The weather conditions at the time of inspection can affect the discoveries of an inspection. Unusually dry or rainy weather will influence what the inspector is able to find.

Evidence of Leaks: Dry Leaks

Evidence of leaking was viewed at the time of inspection. A moisture meter indicated that the stains were dry at the time of inspection.



Bedroom 2 Closet

Limitations

Evidence of Leaks

EXTENT OF DAMAGE

RHI Home Inspections Page 41 of 65

Inspector is unable to determine extent of any damage caused by leaks noted in the report. We recommend having a qualified contractor determine the cause and extent of the damage from noted

Observations

PAINT / WALLPAPER

10.2.1 Walls

Maintenance / Recommendations WALL(S) - DETERIORATED

Wall paint or paper was noted as deteriorated at the time of inspection. This deterioration can appear as blistering, cracking, peeling, or any other surface blemish. Recommend further evaluation & correction by a qualified contractor.

Here is a DIY article on treating cracking paint.

Recommendation Repaired

Contact a qualified painting contractor.



Maintenance / Recommendations

10.2.2 Walls

WALL(S) - MINOR DAMAGE

MULTIPLE LOCATIONS

Minor damage was noted on one or more walls, such as dings, scuffs, or hairline cracks, at the time of inspection. Damage appeared to be cosmetic and not of significant impact to wall coverings. Recommend monitoring for further degradation.

Repaired Recommendation

Contact a qualified professional.





10.4.1 Doors

DOOR(S) - HARDWARE LOOSE

Maintenance / Recommendations

Hardware was noted as loose on interior door(s) at the time of inspection. Recommend tightening door hardware.

Recommendation

Contact a handyman or DIY project



RHI Home Inspections Page 42 of 65

10.5.1 Floors

FLOORING - HEAVY WEAR



MULTIPLE LOCATIONS

Flooring noted showing signs of heavy wear at the time of inspection. This is not effecting the function of the flooring. Recommend monitoring for further degradation of flooring.

Recommendation

Recommend monitoring.

Replaced



Maintenance / Recommendations

10.5.2 Floors

CARPET - STAINS

MULTIPLE LOCATIONS

Carpet noted as stained or discolored at the time of inspection. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Replaced

Contact a carpet cleaner.





10.5.3 Floors

TILE - MISSING / DETERIORATED GROUT



Missing or deteriorated grout was noted on tile flooring at the time of inspection. Re-grouting of tile floors is regularly required over time. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified tile contractor



10.5.4 Floors

SUBFLOOR - UNEVEN

Maintenance / Recommendations

RHI Home Inspections Page 43 of 65

The flooring was noted as uneven at the time of inspection. The exact cause can be difficult to determine but it is typically caused by settlement of framing members over time. Although this condition does not affect the function of the floor, it usually can be corrected by adding additional supports to the flooring system. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified professional.



RHI Home Inspections Page 44 of 65

11: BATHROOMS

Information

Showers / Tubs: Bath Types Cabinets & Counters: Counter Sinks: Sink Features Fixed Tub/Shower **Type** None

Solid-Surface

Mirrors: No Significant Defects Observed

Mirrors were inspected for damage, proper attachment, etc. No notable defects wer found at the time of inspection unless otherwise noted in the report.

Cabinets & Counters: No Significant Defects Observed

Cabinets and countertops were inspected for damage or deficiencies. No reportable defects were viewed at the time of inspection. We recommend double-checking inside cabinets during your final walkthrough since personal belongings are typically stored in these areas and are likely to limit our inspection.

Bath Fans: No Significant Defects Observed

All bath fans were tested and were operable at the time of the inspection. Some ventilation defects, if any may be found in the attic portion of the report.

Limitations

Bath Fans

INSULATION/ FLOORING COVER

Insulation and/or flooring cover in the attic prevented full inspection of bath fan(s) at the time of the inspection

Observations

11.2.1 Cabinets & Counters

Maintenance / Recommendations

COUNTER(S) - MISSING / **DETERIORATED CAULKING**

One or more counters noted as having missing, or damaged caulking against the wall at the time of inspection. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a handyman or DIY project



11.3.1 Sinks

DRAIN LINE(S) - IMPROPER REPAIR



RHI Home Inspections Page 45 of 65

Drain line was noted with an improper repair at the time of inspection. Recommend further evaluation and correction by qualified contractor.

Recommendation

Contact a qualified plumbing contractor.

Repaired



Bathroom 2

11.4.1 Toilets

TOILET - LOOSE AT FLOOR

MULTIPLE LOCATIONS

One or more toilets were noted as loose at floor at the time of the inspection. This allows the toilet to move and can damage the wax ring under the toilet. The wax ring must have a snug, secure fit in order to keep from leaking. This type of damage is not always visible or accessible to the inspector. Recommend further evaluation & correction by a qualified contractor.



Contact a qualified plumbing contractor.



11.5.1 Showers / Tubs

Maintenance / Recommendations SURROUND - MISSING / **DETERIORATED CAULKING**

Caulking around one or more tubs or showers were noted as deteriorated / missing at the time of the inspection. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a handyman or DIY project



11.5.2 Showers / Tubs

FIXTURE - LOOSE

One or more tub / shower fixtures were noted at loose at the time of the inspection. Recommend further evaluation & correction by a qualified contractor. Repaired

Recommendation

Contact a qualified plumbing contractor.



11.5.3 Showers / Tubs

FIXTURE - IMPROPERLY SEALED



RHI Home Inspections Page 46 of 65

Openings were noted where one or more fixtures meet the surround at the time of the inspection. This condition can allow moisture into the wall cavity. Recommend further evaluation & correction by a qualified contractor.

Repaired

Recommendation

Contact a qualified plumbing contractor.



RHI Home Inspections Page 47 of 65

12: KITCHEN

Information

Cabinets & Counters: Counter Type

Formica-Laminate

Sinks: Sink Features

Spray Wand, Garbage Disposal

Built-in Microwave: General Photo(s)

Appliance in operation

Electric



Built-in Microwave: Exhaust Hood Cooking Appliances & Ventilation: Cooking Appliances & Ventilation: General Photo(s) **Appliance Energy Source** Type


Recirculating

Appliance in operation



Refrigerator: General Photo(s) **Refrigerator: Fridge Components** Icemaker

Appliance in operation

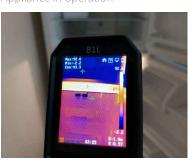

Cabinets & Counters: No Significant Defects Observed

Cabinets and countertops were inspected for damage or deficiencies. No reportable defects were viewed at the time of inspection. We recommend double-checking inside cabinets during your final walkthrough since personal belongings are typically stored in these areas and are likely to limit our inspection.

RHI Home Inspections Page 48 of 65

Built-in Microwave: No Significant Defects Observed

The microwave was operated by operating with normal controls, and was functional at the time of inspection. No deficiencies were observed with the unit unless otherwise noted in this report.

Cooking Appliances & Ventilation: Exhaust Hood Type

Recirculating, Microwave

If the exhaust fan is noted as the microwave, all associated defects will be noted in the Microwave section of the report.

Refrigerator: No Significant Defects Observed

The refrigerator was operated by operating with normal controls, and was functional at the time of inspection. No deficiencies were observed with the unit unless otherwise noted in this report.

Observations

12.2.1 Sinks

DISPOSAL - EXCESSIVE NOISE / VIBRATION



Garbage disposal was excessively noisy or vibrating at the time of inspection. This typically indicates that debris is stuck in the disposal or the unit is worn and needs to have maintenance performed or be replaced. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Replaced

Contact a qualified plumbing contractor.

12.3.1 Dishwasher




DISHWASHER - MISSING HIGH LOOP

Lack of a proper high loop or air gap was noted at dishwasher drain line at the time of inspection. In the event of a drain backing up a high loop prevents waste from entering into the dishwasher. Recommend further evaluation & correction by a qualified contractor.

Replaced

Recommendation

Contact a handyman or DIY project

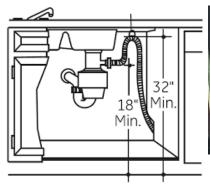



12.3.2 Dishwasher

DISHWASHER-IMPROPERLY DRAINING



RHI Home Inspections Page 49 of 65

Dishwasher noted as improperly draining at the time of inspection. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Replaced

Contact a qualified plumbing contractor.



12.5.1 Cooking Appliances & Ventilation

 
A Structural / Safety Hazard

APPLIANCE - ANTI-TIP BRACKET MISSING / NON-FUNCTIONAL

Appliance was noted as not securely fastened to the floor or wall at the time of the inspection. This poses a safety hazard to children. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified appliance repair professional.



RHI Home Inspections Page 50 of 65

13: LAUNDRY

Information

Dryer Connections: Hook-Up Type

Electric



Washer Hook-Ups: General Photos



Dryer Connections: No Significant Defects Observed

Dryer vents were inspected for functionality, leaks, and damage. No reportable defects were viewed at the time of the inspection.

Washer Hook-Ups: Washer Pan Recommended

No leak pan was noted where the washing machine sits at the time of the inspection. Water damage may occur if the washing machine leaks. These are always recommended, but especially when present on a floor above another liveable area. Recommend further evaluation by a qualified contractor.

Washer Hook-Ups: No Significant Defects Observed

Washer fixtures were inspected for functionality, leaks, and damage. No reportable defects were viewed at the time of the inspection.

Observations

13.1.1 Cabinets & Counters



CABINET(S) - IMPROPER FASTENERS

Cabinets were noted as being improperly mounted at the time of inspection. A cabinet screw that has a flat head which prevents the screw from pulling out should be used. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified cabinet contractor.



RHI Home Inspections Page 51 of 65

14: FOUNDATION

Information

Foundation: Type of Foundation Foundation: Drainage Type

Crawlspace

Sump Pump

Walls, Beams, & Columns: Wall Material

Cinder Blocks

Walls, Beams, & Columns:

Columns and Beams Wooden Beams, Masonry Piers **Subfloor: Material**

Dimensional Lumber, Plywood

Sheathing

Crawlspace: Crawlspace Access

Location Exterior



Crawlspace: Floor Type

Dirt

Ventilation: Ventilation Type Side Vents

Insulation: Insulation Covering Roll Insulation, Band Board, Floor Joists

RHI Home Inspections Page 52 of 65

Foundation: General Photos



Evidence of Leaks: Inclement Weather

The weather conditions at the time of inspection can affect the discoveries of an inspection. Unusually dry or rainy weather will influence what the inspector is able to find.

Evidence of Leaks: Leaks - Dry

Evidence of leaking was viewed at the time of inspection. A moisture meter indicated that the stains were dry at the time of inspection.



Limitations

RHI Home Inspections Page 53 of 65

Foundation

LIMITED ACCESS TO FOUNDATION AREAS

UTILITIES & INSULATION 25%-50% Inaccessible

Portion selected of the foundation were noted as inaccessible at the time of inspection. This may be for various reasons including but not limited to standing water, vermin, belongings, low clearances, ductwork, and/or plumbing.

Walls, Beams, & Columns

ANCHOR BOLTS NOT VISIBLE

Anchor Bolts were not visible at the time of inspection, so they were not able to be evaluated.

Evidence of Leaks

EXTENT OF DAMAGE

Inspector is unable to determine extent of any damage caused by leaks noted in the report. We recommend having a qualified contractor determine the cause and extent of the damage from noted areas.

Observations

14.1.1 Foundation



 
MUSTY SMELL

A musty smell was noted in the foundation - this can be an indicator of potential mold in the foundation. RHI can perform mold sampling and air quality tests for an addition charge.

Recommendation Repaired

Contact a qualified mold inspection professional.

14.1.2 Foundation



DEHUMIDIFIER RECOMMENDED

Recommend that a dehumidifier be run in foundation areas where there is not HVAC. This will help to prevent high humidity and potential mold growth.

Recommendation

Contact a qualified professional.

14.3.1 Walls, Beams, & Columns

Maintenance / Recommendations

FOUNDATION WALL(S) EFFLORESCENCE / STAINS

RHI Home Inspections Page 54 of 65

Efflorescence (white mineral deposits) or stains were noted on foundation wall(s). This is a common condition caused by moisture slowly infiltrating through the block, either recently or at some time in the past. Recommend regular maintenance and monitoring to prevent unwanted deterioration.

Recommendation

Repaired

Contact a handyman or DIY project



14.3.2 Walls, Beams, & Columns

Deficiencies

FOUNDATION WALL(S) - MOISTURE INTRUSION

Evidence of moisture was noted at one or more areas of the foundation wall. Moisture may be intruding on the foundation for varying reasons. Recommend further evaluation & correction by a qualified contractor.

Repaired

 
Recommendation

Contact a foundation contractor.



14.3.3 Walls, Beams, & Columns

FOUNDATION WALL(S) - GAPS TO EXTERIOR



Recommendation

Contact a qualified professional.



14.4.1 Crawlspace

VAPOR BARRIER - DEBRIS



There is an excessive amount of debris / trash noted in the crawlspace at the time of inspection. This may attract pests and make it difficult for any, if necessary, work to be done. Recommend removal of debris and trash.

Repaired

Recommendation

Contact a handyman or DIY project



14.4.2 Crawlspace

VAPOR BARRIER - STANDING WATER

MULTIPLE LOCATIONS



RHI Home Inspections Page 55 of 65

Standing water was noted in the crawlspace at the time of inspection. The inspector is unable to determine the sole source of the water. Water in the crawlspace may lead to multiple other issues. Recommend further evaluation & correction by a qualified contractor.

Recommendation Repaired

Contact a foundation contractor.





14.4.3 Crawlspace

VAPOR BARRIER - MULTIPLE LAYERS



Multiple layers of vapor barrier were noted at the time of inspection. This also includes excessive overlapping. Only one layer of vapor barrier should be present and overlapping should not exceed 12 inches because moisture can get trapped between the two layers . Recommend further evaluation & correction by a qualified contractor.

Recommendation

 
Contact a foundation contractor.



14.4.4 Crawlspace

VAPOR BARRIER - MISSING / DAMAGED / IMPROPER





Repaired

Recommendation

Contact a foundation contractor.





RHI Home Inspections Page 56 of 65

14.4.5 Crawlspace

GROUND - MUDDY



Crawlspace ground was noted as muddy at the time of inspection. This may indicate moisture is having difficulty draining and drying out. Recommend further evaluation & correction by qualified contractor. Repaired

Recommendation

Contact a qualified professional.

14.6.1 Insulation

INSULATION - MISSING / OUT OF PLACE

THROUGHOUT CRAWLSPACE

Insulation was noted as missing or out of place in some areas at the time of the inspection. This will result in energy loss. Recommend further evaluation & correction by a qualified contractor.

Recommendation

Contact a qualified insulation contractor.







RHI Home Inspections Page 57 of 65

15: ENVIRONMENTAL

Information

Pest Activity: Pest Information

Inspecting for, and reporting on the presence of WDI activity (wood destroying organisms) including but not limited to; termites, powder post beetles, carpenter ants, carpenter bees, etc. as well as other pests, is beyond the scope of a home inspection and is excluded by our Standards of Practice. It is highly recommended that you have a WDI-Termite inspection prior to the end of your inspection contingency period. RHI offers this service for an additional charge.

More Info at https://yourrhi.com/termite-inspections/

Animal Activity: No Significant Defects Observed

Inspecting for pests and animals is outside the Standards of Practice for home inspectors. However, we will attempt to report any evidence of a pest infestation for the benefit of our clients. Also, please be aware that animals may enter most attics and crawlspaces at any point in time, particularly when the weather turns cold.

Thermal Scan

A basic scan of the house was performed with an infrared camera to check for leaks, missing insulation, and overheated electrical conductors. This scan does not ensure the inspector will find all defects that may be hidden in walls or ceilings. Any specific defects that were found pertaining to specific components will be noted in their respective areas of the report.



Fungal Growth: Mold Testing Not Conducted

Mold sampling was not conducted. We recommend testing any items suspected to fungal growth to confirm the presence of mold or not. This is an additional service we offer.

More Info at https://yourrhi.com/mold-services/

Radon: Radon Test Recommended

The EPA and the Surgeon General recommend that all homes be tested for radon. Radon is the second leading cause of lung cancer in the United States. RHI can perform a radon test for you or refer you to another company for testing. You can also obtain a test kit and test on your own. If elevated radon levels are found a mitigation system can be installed to ensure safe levels within a home.

More Info at https://yourrhi.com/radon-testing/

Lead: Lead in Structures Before 1978

If a structure was built before 1978, it is more likely to have lead-based paint. In 1978, the federal government banned consumer uses of lead-based paint, but some states banned it even earlier. This testing is beyond the scope of a standard inspection. RHI recommend have a swab test performed to tell weather lead paint has been properly encapsulated.

More Info at https://yourrhi.com/lead-based-paint-testing/

RHI Home Inspections Page 58 of 65

Asbestos: Suspected asbestos - No Sample Taken

Suspected asbestos noted. Asbestos was widely used prior to the 1980s and is commonly found in older structures. Please note determining the existence of environmental hazards like asbestos is beyond the scope of this inspection. You may want to obtain further evaluation by a licensed asbestos abatement contractor or have the suspected asbestos sealed by a professional. RHI can perform testing to confirm the presence of asbestos for an additional charge.

Asbestos: Suspected Asbestos - Popcorn Ceiling

Suspected asbestos Ceiling texture noted. Asbestos was widely used prior to the 1980s and is commonly found in older structures. Please note determining the existence of environmental hazards like asbestos is beyond the scope of this inspection. You may want to obtain further evaluation by a licensed asbestos abatement contractor or have the suspected asbestos sealed by a professional. RHI can perform testing to confirm the presence of asbestos for an additional charge.



Asbestos: Asbestos in Structures Before 1980

Asbestos was widely used prior to the 1980s and is commonly found in older structures. Please note determining the existence of environmental hazards like asbestos is beyond the scope of this inspection. You may want to obtain further evaluation by a licensed asbestos abatement contractor or have the suspected asbestos sealed by a professional. RHI can perform testing to confirm the presence of asbestos for an additional charge.

Observations

15.3.1 Fungal Growth

SUSPECTED FUNGAL GROWTH - NOT TESTED

Suspected fungal growth was noted at the time of the inspection. Some types of mold can have negative health effects but proper remediation of any mold may eliminate negative side effects. Recommend further evaluation & correction by a qualified contractor. RHI can take a mold sample to have lab analysis performed to confirm this for an addition charge.

More Info at https://yourrhi.com/mold-services/

Recommendation Repaired

Contact a qualified mold remediation contractor





Attic

15.3.2 Fungal Growth

SIGNIFICANT FUNGAL GROWTH - NOT TESTED

THROUGHOUT CRAWLSPACE

Structural / Safety Hazard

RHI Home Inspections Page 59 of 65

Significant fungal growth was noted at the time of inspection. Some types of mold can have negative health effects but proper remediation of any mold may eliminate negative side effects. Recommend further evaluation & correction by a qualified contractor. RHI can take a mold sample to have lab analysis performed to confirm this for an addition charge.

More Info at https://yourrhi.com/mold-services/

Recommendation

Contact a qualified mold remediation contractor

Repaired



RHI Home Inspections Page 60 of 65

16: FIRE SAFETY

Information

Smoke Alarms: Locations

Hallways

It is recommended that smoke alarms be installed inside each bedroom, outside each sleeping area and on every level of the home, including the basement.



Smoke Alarms: Smoke Alarm Maintenance

Smoke alarms should be tested and have their batteries regularly replaced to ensure proper function of the system. Smoke alarms in general have around a 10 year lifespan and should be replaced when nearing this life, when changing ownership of a property, or when the units no longer function properly.

Limitations

 
Smoke Alarms

NOT TESTED

Smoke alarms were not tested at the time of the inspection. Recommend testing all smoke alarms and changing all batteries when you take possession of the house.

Observations

16.1.1 Smoke Alarms



SMOKE ALARM(S) - INSUFFICIENT NUMBER

An insufficient number of smoke alarms were noted in the property at the time of inspection. It is recommended that smoke alarms be installed inside each bedroom, outside each sleeping area and on every level of the home, including the basement. Recommend properly placing for safety of occupants.

Recommendation

Contact a qualified professional.



RHI Home Inspections Page 61 of 65

17: END OF INSPECTION CHECKLIST

Information

Pre Paid

Checklist: GFCI Outlets Reset -Yes

Checklist: All water fixtures double checked and off - Yes

Checklist: Kitchen Appliances Off Checklist: Thermostats Returned - Yes

Checklist: Lights Off (Or Returned As Found) - Yes

to Original Settings - Yes



Checklist: Ladder, Tools and **Personal Belongings - Yes**



Checklist: Leave Behind Card -Yes

Checklist: All Exterior Doors Locked - Yes

RHI Home Inspections Page 62 of 65

STANDARDS OF PRACTICE

Inspection Details

1. Definitions and Scope 1.1. A home inspection is a non-invasive, visual examination of the accessible areas of a residential property (as delineated below), performed for a fee, which is designed to identify defects within specific systems and components defined by these Standards that are both observed and deemed material by the inspector. The scope of work may be modified by the Client and Inspector prior to the inspection process. I. The home inspection is based on the observations made on the date of the inspection, and not a prediction of future conditions. II. The home inspection will not reveal every issue that exists or ever could exist, but only those material defects observed on the date of the inspection. 1.2. A material defect is a specific issue with a system or component of a residential property that may have a significant, adverse impact on the value of the property, or that poses an unreasonable risk to people. The fact that a system or component is near, at, or beyond the end of its normal, useful life is not, in itself, a material defect, 1,3, A home inspection report shall identify, in written format, defects within specific systems and components defined by these Standards that are both observed and deemed material by the inspector. Inspection reports may include additional comments and recommendations. 2. Limitations, Exceptions & Exclusions 2.1. Limitations: I. An inspection is not technically exhaustive. II. An inspection will not identify concealed or latent defects. III. An inspection will not deal with aesthetic concerns, or what could be deemed matters of taste, cosmetic defects, etc. IV. An inspection will not determine the suitability of the property for any use. V. An inspection does not determine the market value of the property or its marketability. VI. An inspection does not determine the insurability of the property. VII. An inspection does not determine the advisability or inadvisability of the purchase of the inspected property. VIII. An inspection does not determine the life expectancy of the property or any components or systems therein. IX. An inspection does not include items not permanently installed. X. This Standards of Practice applies to properties with four or fewer residential units and their attached garages and carports. 2.2. Exclusions: I. The inspector is not required to determine: A. property boundary lines or encroachments. B. the condition of any component or system that is not readily accessible. C. the service life expectancy of any component or system. D. the size, capacity, BTU, performance or efficiency of any component or system. E. the cause or reason of any condition. F. the cause for the need of correction, repair or replacement of any system or component. G. future conditions. H. compliance with codes or regulations. I. the presence of evidence of rodents, birds, bats, animals, insects, or other pests. J. the presence of mold, mildew or fungus. K. the presence of airborne hazards, including radon. L. the air quality. M. the existence of environmental hazards, including lead paint, asbestos or toxic drywall. N. the existence of electromagnetic fields. O. any hazardous waste conditions. P. any manufacturers' recalls or conformance with manufacturer installation, or any information included for consumer protection purposes, Q. acoustical properties, R. correction, replacement or repair cost estimates, S. estimates of the cost to operate any given system. II. The inspector is not required to operate: A. any system that is shut down. B. any system that does not function properly. C. or evaluate low-voltage electrical systems, such as, but not limited to: 1. phone lines; 2. cable lines; 3. satellite dishes; 4. antennae; 5. lights; or 6. remote controls. D. any system that does not turn on with the use of normal operating controls. E. any shut-off valves or manual stop valves. F. any electrical disconnect or over-current protection devices. G. any alarm systems. H. moisture meters, gas detectors or similar equipment. III. The inspector is not required to: A. move any personal items or other obstructions, such as, but not limited to: throw rugs, carpeting, wall coverings, furniture, ceiling tiles, window coverings, equipment, plants, ice, debris, snow, water, dirt, pets, or anything else that might restrict the visual inspection. B. dismantle, open or uncover any system or component. C. enter or access any area that may, in the inspector's opinion, be unsafe. D. enter crawlspaces or other areas that may be unsafe or not readily accessible. E. inspect underground items, such as, but not limited to: lawn-irrigation systems, or underground storage tanks (or indications of their presence), whether abandoned or actively used. F. do anything that may, in the inspector's opinion, be unsafe or dangerous to him/herself or others, or damage property, such as, but not limited to: walking on roof surfaces, climbing ladders, entering attic spaces, or negotiating with pets. G. inspect decorative items. H. inspect common elements or areas in multi-unit housing. I. inspect intercoms, speaker systems or security systems. J. offer guarantees or warranties. K. offer or perform any engineering services. L. offer or perform any trade or professional service other than a home inspection. M. research the history of the property, or report on its potential for alteration, modification, extendibility or suitability for a specific or proposed use for occupancy. N. determine the age of construction or installation of any system, structure or component of a building, or differentiate between original construction and subsequent additions, improvements, renovations or replacements. O. determine the insurability of a property. P. perform or offer Phase 1 or environmental audits. Q. inspect any system or component that is not included in these Standards.

Exterior

I. The inspector **shall inspect**: A. the exterior wall-covering materials, flashing and trim; B. all exterior doors; C. adjacent walkways and driveways; D. stairs, steps, stoops, stairways and ramps; E. porches, patios, decks, balconies and carports; F. railings, guards and handrails; G. the eaves, soffits and fascia; H. a representative number of windows; and I. vegetation, surface drainage, retaining walls and grading of the property, where they may adversely affect the structure due to moisture intrusion. II. The inspector shall describe: A. the type of exterior wall-covering materials. III. The inspector shall report as in need of correction: A. any improper spacing between intermediate balusters, spindles and rails. IV. The inspector **is not required to**: A. inspect or operate screens, storm windows, shutters, awnings, fences, outbuildings, or exterior accent lighting. B. inspect items that are not visible or readily accessible from the ground, including window and door flashing. C. inspect or identify geological, geotechnical, hydrological or soil conditions. D. inspect recreational facilities or playground equipment. E. inspect seawalls, breakwalls or docks. F. inspect erosion-control or earth-

RHI Home Inspections Page 63 of 65

stabilization measures. G. inspect for safety-type glass. H. inspect underground utilities. I. inspect underground items. J. inspect wells or springs. K. inspect solar, wind or geothermal systems. L. inspect swimming pools or spas. M. inspect wastewater treatment systems, septic systems or cesspools. N. inspect irrigation or sprinkler systems. O. inspect drainfields or dry wells. P. determine the integrity of multiple-pane window glazing or thermal window seals.

Roof & Chimnevs

I. The inspector **shall inspect from ground level or the eaves**: A. the roof-covering materials; B. the gutters; C. the downspouts; D. the vents, flashing, skylights, chimney, and other roof penetrations; and E. the general structure of the roof from the readily accessible panels, doors or stairs. II. The inspector shall describe: A. the type of roof-covering materials. III. The inspector shall report as in need of correction: A. observed indications of active roof leaks. IV. The inspector is **not required to**: A. walk on any roof surface. B. predict the service life expectancy. C. inspect underground downspout diverter drainage pipes. D. remove snow, ice, debris or other conditions that prohibit the observation of the roof surfaces. E. move insulation. F. inspect antennae, satellite dishes, lightning arresters, de-icing equipment, or similar attachments. G. walk on any roof areas that appear, in the inspectors opinion, to be unsafe. H. walk on any roof areas if doing so might, in the inspector's opinion, cause damage. I. perform a water test. J. warrant or certify the roof. K. confirm proper fastening or installation of any roof-covering material.

Attic

I. The inspector **shall inspect**: A. insulation in unfinished spaces, including attics, crawlspaces and foundation areas; B. ventilation of unfinished spaces, including attics, crawlspaces and foundation areas; and C. mechanical exhaust systems in the kitchen, bathrooms and laundry area. II. The inspector shall describe: A. the type of insulation observed; and B. the approximate average depth of insulation observed at the unfinished attic floor area or roof structure. III. The inspector shall report as in need of correction: A. the general absence of insulation or ventilation in unfinished spaces. IV. The inspector **is not required to**: A. enter the attic or any unfinished spaces that are not readily accessible, or where entry could cause damage or, in the inspector's opinion, pose a safety hazard. B. move, touch or disturb insulation. C. move, touch or disturb vapor retarders. D. break or otherwise damage the surface finish or weather seal on or around access panels or covers. E. identify the composition or R-value of insulation material. F. activate thermostatically operated fans. G. determine the types of materials used in insulation or wrapping of pipes, ducts, jackets, boilers or wiring. H. determine the adequacy of ventilation.

HVAC & Fireplaces

I. The inspector **shall inspect**: A. the heating system, using normal operating controls. II. The inspector shall describe: A. the location of the thermostat for the heating system; B. the energy source; and C. the heating method. III. The inspector shall report as in need of correction: A. any heating system that did not operate; and B. if the heating system was deemed inaccessible. IV. The inspector **is not required to**: A. inspect or evaluate the interior of flues or chimneys, fire chambers, heat exchangers, combustion air systems, fresh-air intakes, humidifiers, dehumidifiers, electronic air filters, geothermal systems, or solar heating systems. B. inspect fuel tanks or underground or concealed fuel supply systems. C. determine the uniformity, temperature, flow, balance, distribution, size, capacity, BTU, or supply adequacy of the heating system. D. light or ignite pilot flames. E. activate heating, heat pump systems, or other heating systems when ambient temperatures or other circumstances are not conducive to safe operation or may damage the equipment. F. override electronic thermostats. G. evaluate fuel quality. H. verify thermostat calibration, heat anticipation, or automatic setbacks, timers, programs or clocks.

Electrical

I. The inspector shall inspect: A. the service drop; B. the overhead service conductors and attachment point; C. the service head, gooseneck and drip loops; D. the service mast, service conduit and raceway; E. the electric meter and base; F. service-entrance conductors; G. the main service disconnect; H. panelboards and over-current protection devices (circuit breakers and fuses); II. service grounding and bonding; J. a representative number of switches, lighting fixtures and receptacles, including receptacles observed and deemed to be arc-fault circuit interrupter (AFCI)-protected using the AFCI test button, where possible; K. all ground-fault circuit interrupter receptacles and circuit breakers observed and deemed to be GFCIs using a GFCI tester, where possible; and L. smoke and carbon-monoxide detectors. II. The inspector shall describe: A. the main service disconnect's amperage rating, if labeled; and B. the type of wiring observed. III. The inspector shall report as in need of correction: A. deficiencies in the integrity of the service drip loop, and vertical clearances from grade and roofs; B. any unused circuit-breaker panel opening that was not filled; C. the presence of solid conductor aluminum branch-circuit wiring, if readily visible; D. any tested receptacle in which power was not present, polarity was incorrect, the cover was not in place, the GFCI devices were not properly installed or did not operate properly, evidence of arcing or excessive heat, and where the receptacle was not grounded or was not secured to the wall; and E. the absence of smoke detectors. IV. The inspector is not required to: A. insert any tool, probe or device into the main panelboard, sub-panels, distribution panelboards, or electrical fixtures. B. operate électrical systems that are shut down. C. remove panelboard cabinet covers or dead fronts. D. operate or re-set over-current protection devices or overload devices. E. operate or test smoke or carbon-monoxide detectors or alarms F. inspect, operate or test any security, fire or alarms systems or components, or other warning or signaling systems. G. measure or determine the amperage or voltage of the main service equipment, if not visibly labeled. H. inspect ancillary wiring or remote-control devices. I. activate any electrical systems or branch circuits that are not energized. J. inspect low-voltage systems, electrical de-icing tapes, swimming pool wiring, or any timecontrolled devices. K. verify the service ground. L. inspect private or emergency electrical supply sources, including, but not limited to: generators, windmills, photovoltaic solar collectors, or battery or electrical storage facility. M. inspect spark or lightning arrestors. N. inspect or test de-icing equipment. O. conduct voltage-drop calculations. P. determine the accuracy of labeling. Q. inspect exterior lighting.

RHI Home Inspections Page 64 of 65

Plumbing

I. The inspector **shall inspect**: A. the main water supply shut-off valve; B. the main fuel supply shut-off valve; C. the water heating equipment, including the energy source, venting connections, temperature/pressure-relief (TPR) valves, Watts 210 valves, and seismic bracing; D. interior water supply, including all fixtures and faucets, by running the water; E. all toilets for proper operation by flushing; F. all sinks, tubs and showers for functional drainage; G. the drain, waste and vent system; and H. drainage sump pumps with accessible floats.

II. The inspector shall describe: A. whether the water supply is public or private based upon observed evidence; B. the location of the main water supply shut-off valve; C. the location of the main fuel supply shut-off valve; D. the location of any observed fuel-storage system; and E. the capacity of the water heating equipment, if labeled.

III. The inspector shall report as in need of correction: A. deficiencies in the water supply by viewing the functional flow in two fixtures operated simultaneously; B. deficiencies in the installation of hot and cold water faucets; C. mechanical drain stops that were missing or did not operate if installed in sinks, lavatories and tubs; and D. toilets that were damaged, had loose connections to the floor, were leaking, or had tank components that did not operate.

IV. The inspector is not required to: A. light or ignite pilot flames. B. measure the capacity, temperature, age, life expectancy or adequacy of the water heater. C. inspect the interior of flues or chimneys, combustion air systems, water softener or filtering systems, well pumps or tanks, safety or shut-off valves, floor drains, lawn sprinkler systems, or fire sprinkler systems. D. determine the exact flow rate, volume, pressure, temperature or adequacy of the water supply. E. determine the water quality, potability or reliability of the water supply or source. F. open sealed plumbing access panels. G. inspect clothes washing machines or their connections. H. operate any valve. I. test shower pans, tub and shower surrounds or enclosures for leakage or functional overflow protection. I. evaluate the compliance with conservation, energy or building standards, or the proper design or sizing of any water, waste or venting components, fixtures or piping. K. determine the effectiveness of anti-siphon, backflow prevention or drain-stop devices. L. determine whether there are sufficient cleanouts for effective cleaning of drains. M. evaluate fuel storage tanks or supply systems. N. inspect wastewater treatment systems. O. inspect water treatment systems or water filters. P. inspect water storage tanks, pressure pumps, or bladder tanks. Q. evaluate wait time to obtain hot water at fixtures, or perform testing of any kind to water heater elements. R. evaluate or determine the adequacy of combustion air. S. test, operate, open or close: safety controls, manual stop valves, temperature/pressure-relief valves, control valves, or check valves. T. examine ancillary or auxiliary systems or components, such as, but not limited to, those related to solar water heating and hot water circulation. U. determine the existence or condition of polybutylene plumbing. V. inspect or test for gas or fuel leaks, or indications thereof

Interior

I. The inspector shall inspect: A. a representative number of doors and windows by opening and closing them; B. floors, walls and ceilings; C. stairs, steps, landings, stairways and ramps; D. railings, guards and handrails; and E. garage vehicle doors and the operation of garage vehicle door openers, using normal operating controls. II. The inspector shall describe: A. a garage vehicle door as manually-operated or installed with a garage door opener. III. The inspector shall report as in need of correction: A. improper spacing between intermediate balusters, spindles and rails for steps, stairways, guards and railings; B. photo-electric safety sensors that did not operate properly; and C. any window that was obviously fogged or displayed other evidence of broken seals. IV. The inspector **is not required to**: A. inspect paint, wallpaper, window treatments or finish treatments. B. inspect floor coverings or carpeting. C. inspect central vacuum systems. D. inspect for safety glazing. E. inspect security systems or components. F. evaluate the fastening of islands, countertops, cabinets, sink tops or fixtures. G. move furniture, stored items, or any coverings, such as carpets or rugs, in order to inspect the concealed floor structure. H. move suspended-ceiling tiles. I. inspect or move any household appliances. J. inspect or operate equipment housed in the garage, except as otherwise noted. K. verify or certify the proper operation of any pressure-activated auto-reverse or related safety feature of a garage door. L. operate or evaluate any security bar release and opening mechanisms, whether interior or exterior, including their compliance with local, state or federal standards. M. operate any system, appliance or component that requires the use of special keys, codes, combinations or devices. N. operate or evaluate self-cleaning oven cycles, tilt guards/latches, or signal lights. O. inspect microwave ovens or test leakage from microwave ovens. P. operate or examine any sauna, steamgenerating equipment, kiln, toaster, ice maker, coffee maker, can opener, bread warmer, blender, instant hot-water dispenser, or other small, ancillary appliances or devices. Q. inspect elevators. R. inspect remote controls. S. inspect appliances. T. inspect items not permanently installed. U. discover firewall compromises. V. inspect pools, spas or fountains. W. determine the adequacy of whirlpool or spa jets, water force, or bubble effects. X. determine the structural integrity or leakage of pools or spas.

Foundation

I. The inspector **shall inspect**: A. the foundation; B. the basement; C. the crawlspace; and D. structural components. II. The inspector shall describe: A. the type of foundation; and B. the location of the access to the under-floor space. III. The inspector shall report as in need of correction: A. observed indications of wood in contact with or near soil; B. observed indications of active water penetration; C. observed indications of possible foundation movement, such as sheetrock cracks, brick cracks, out-of-square door frames, and unlevel floors; and D. any observed cutting, notching and boring of framing members that may, in the inspector's opinion, present a structural or safety concern. IV. The inspector **is not required to**: A. enter any crawlspace that is not readily accessible, or where entry could cause damage or pose a hazard to him/herself. B. move stored items or debris. C. operate sump pumps with inaccessible floats. D. identify the size, spacing, span or location or determine the adequacy of foundation bolting, bracing, joists, joist spans or support systems. E. provide any engineering or architectural service. F. report on the adequacy of any structural system or component.

RHI Home Inspections Page 65 of 65