



Stanfield Air Systems
 1130 Mitchell Bridge Rd.
 Athens, Georgia 30606
 (706) 549-4767
 www.stanfieldair.com

BILL TO
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

FRIDAY APRIL 10, 2026
 12:00 - 6:00

ESTIMATE 97729372	ESTIMATE DATE Apr 01, 2026
-----------------------------	--------------------------------------

JOB ADDRESS
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

Job: 86231239

ESTIMATE DETAILS

Replace dual capacitor 20-50 mfd with Turbo 200 (Better): Replace dual run capacitor up to 20 - 50 microfarad with Turbo 200 with 5 year part warranty.

SERVICE	DESCRIPTION	QTY	STANDARD PRICE	PRICE	TOTAL
CAP-191	Install a turbo 200 universal replacement capacitor up to 90 mfd. B0.45	1.00	\$353.00	\$300.05	\$300.05

MEMBER SAVINGS	\$52.95
SUB-TOTAL	\$300.05
TOTAL	\$300.05

Thank you for choosing Stanfield Air Systems

CUSTOMER AUTHORIZATION

THIS IS AN ESTIMATE, NOT A CONTRACT FOR SERVICES. The summary above is furnished by Stanfield Air Systems as a good faith estimate of work to be performed at the location described above and is based on our evaluation and does not include material price increases or additional labor and materials which may be required should unforeseen problems arise after the work has started. I understand that the final cost of the work may differ from the estimate, perhaps materially. THIS IS NOT A GUARANTEE OF THE FINAL PRICE OF WORK TO BE PERFORMED. I agree and authorize the work as summarized on these estimated terms, and I agree to pay the full amount for all work performed.

Sign here

Date



Stanfield Air Systems
 1130 Mitchell Bridge Rd.
 Athens, Georgia 30606
 (706) 549-4767
 www.stanfieldair.com

BILL TO
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

ESTIMATE 97739175	ESTIMATE DATE Apr 01, 2026
-----------------------------	--------------------------------------

JOB ADDRESS
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

Job: 86231239

ESTIMATE DETAILS

Replace warranty capacitor 20-50 dual run for upstairs outdoor (Good): Replace warranty dual run capacitor up to 20 - 50 microfarad.

SERVICE	DESCRIPTION	QTY	STANDARD PRICE	PRICE	TOTAL
WARRANTY CAPACITOR	WARRANTY CAPACITOR	1.00	\$117.64	\$100.00	\$100.00

MEMBER SAVINGS	\$17.64
SUB-TOTAL	\$100.00
TOTAL	\$100.00

Thank you for choosing Stanfield Air Systems

CUSTOMER AUTHORIZATION

THIS IS AN ESTIMATE, NOT A CONTRACT FOR SERVICES. The summary above is furnished by Stanfield Air Systems as a good faith estimate of work to be performed at the location described above and is based on our evaluation and does not include material price increases or additional labor and materials which may be required should unforeseen problems arise after the work has started. I understand that the final cost of the work may differ from the estimate, perhaps materially. THIS IS NOT A GUARANTEE OF THE FINAL PRICE OF WORK TO BE PERFORMED. I agree and authorize the work as summarized on these estimated terms, and I agree to pay the full amount for all work performed.

Sign here

Date



Stanfield Air Systems
 1130 Mitchell Bridge Rd.
 Athens, Georgia 30606
 (706) 549-4767
 www.stanfieldair.com

BILL TO
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

INVOICE 86231239	INVOICE DATE Apr 01, 2026
----------------------------	-------------------------------------

JOB ADDRESS
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

Completed Date:
Payment Term: Due Upon Receipt

DESCRIPTION OF WORK

Performed planned service agreement on 2 systems. Checked amps, flushed drain lines, replaced filters, and cleaned condenser coils. Noticed both capacitors are reading weak. would recommend replacing upstairs outdoor with the warranty capacitor and the main outdoor with a turbo 200 capacitor. System's are running good at this time.

TASK	DESCRIPTION	QTY	PRICE	TOTAL
Visit Complete	Maintenance Visit Complete	1.00	\$132.00	\$132.00
Visit Credit	Maintenance Visit Credit for prepaid agreement	1.00	-\$132.00	-\$132.00

SUB-TOTAL \$0.00

TOTAL DUE \$0.00

BALANCE DUE \$0.00

Thank you for choosing Stanfield Air Systems

CUSTOMER AUTHORIZATION

This invoice is agreed and acknowledged. Payment is due upon receipt. A service fee will be charged for any returned checks, and a financing charge of 1.5% per month shall be applied for overdue amounts.

Sign here 

Date 4/1/2026

CUSTOMER ACKNOWLEDGEMENT

I find and agree that all work performed by Stanfield Air Systems has been completed in a satisfactory and workmanlike



Job #86231239

Maintenance Checklist (upstairs)

Heating or Cooling Heating or Cooling

Heating or Cooling?

Cooling

System Overview System Overview

Is system a Geothermal?

No

Indoor Indoor

Thermostat

Current and capable of utilizing all of the system's features

Duct Leakage

No or insignificant amounts of air leakage

Duct Insulation

No or insignificant amounts of insulation missing

Evaporator Coil/Corrosion (Include picture)

No leaks or visible corrosion

Filtration System (Please List Size in Customer Information)

Media

PVC Is sch. 40

sch. 40 is a thicker rating of PVC which is less likely to crack or leak. It is especially recommended for systems located in attics.

Pass

Condensate Pump

N/A

Pump Tubing

N/A

Drain Pan

Good Condition

Water Safety System

Code Compliant with backup

Blower Amps

0.87

Job #86231239

Maintenance Checklist (main)

Heating or Cooling Heating or Cooling

Heating or Cooling?

Cooling

System Overview System Overview

Is system a Geothermal?

No

Indoor Indoor

Thermostat

Current and capable of utilizing all of the system's features

Duct Leakage

No or insignificant amounts of air leakage

Duct Insulation

No or insignificant amounts of insulation missing

Evaporator Coil/Corrosion (Include picture)

No leaks or visible corrosion

Filtration System (Please List Size in Customer Information)

Media

PVC Is sch. 40

sch. 40 is a thicker rating of PVC which is less likely to crack or leak. It is especially recommended for systems located in attics.

Pass

Condensate Pump

N/A

Pump Tubing

N/A

Drain Pan

Good Condition

Water Safety System

Code Compliant with backup

Blower Amps

1.23



Stanfield Air Systems
 1130 Mitchell Bridge Rd.
 Athens, Georgia 30606
 (706) 549-4767
 www.stanfieldair.com

BILL TO
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

INVOICE 86231239	INVOICE DATE Apr 01, 2026
----------------------------	-------------------------------------

JOB ADDRESS
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

Completed Date:
Payment Term: Due Upon Receipt
Due Date: 4/1/2026

DESCRIPTION OF WORK

Performed planned service agreement on 2 systems. Checked amps, flushed drain lines, replaced filters, and cleaned condenser coils. Noticed both capacitors are reading weak. would recommend replacing upstairs outdoor with the warranty capacitor and the main outdoor with a turbo 200 capacitor. System's are running good at this time.

4/10/26- Replaced warranty dual run capacitor and replaced main level dual run capacitor with Turbo 200. Ensured proper cooling mode operation for both systems.

TASK	DESCRIPTION	QTY	STANDARD PRICE	PRICE	TOTAL
Visit Complete	Maintenance Visit Complete	1.00	\$132.00	\$132.00	\$132.00
Visit Credit	Maintenance Visit Credit for prepaid agreement	1.00	-\$132.00	-\$132.00	-\$132.00
WARRANTY CAPACITOR	WARRANTY CAPACITOR	1.00	\$117.64	\$100.00	\$100.00
CAP-191	Install a turbo 200 universal replacement capacitor up to 90 mfd. B0.45	1.00	\$353.00	\$300.05	\$300.05

PAID ON	TYPE	MEMO	AMOUNT
4/10/2026	Check		\$400.05



Stanfield Air Systems
 1130 Mitchell Bridge Rd.
 Athens, Georgia 30606
 (706) 549-4767
 www.stanfieldair.com

BILL TO
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

ESTIMATE 97729372	ESTIMATE DATE Apr 01, 2026
-----------------------------	--------------------------------------

JOB ADDRESS
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

Job: 86231239

ESTIMATE DETAILS

Replace dual capacitor 20-50 mfd with Turbo 200 (Better): Replace dual run capacitor up to 20 - 50 microfarad with Turbo 200 with 5 year part warranty.

SERVICE	DESCRIPTION	QTY	STANDARD PRICE	PRICE	TOTAL
CAP-191	Install a turbo 200 universal replacement capacitor up to 90 mfd. B0.45	1.00	\$353.00	\$300.05	\$300.05

MEMBER SAVINGS	\$52.95
SUB-TOTAL	\$300.05
TOTAL	\$300.05

Thank you for choosing Stanfield Air Systems

CUSTOMER AUTHORIZATION

THIS IS AN ESTIMATE, NOT A CONTRACT FOR SERVICES. The summary above is furnished by Stanfield Air Systems as a good faith estimate of work to be performed at the location described above and is based on our evaluation and does not include material price increases or additional labor and materials which may be required should unforeseen problems arise after the work has started. I understand that the final cost of the work may differ from the estimate, perhaps materially. THIS IS NOT A GUARANTEE OF THE FINAL PRICE OF WORK TO BE PERFORMED. I agree and authorize the work as summarized on these estimated terms, and I agree to pay the full amount for all work performed.

Sign here

Date



Job #80857342

Maintenance Checklist (Upstairs)

Heating or Cooling

Heating or Cooling?

Heating

What type of Heating?

Heat Pump

System Overview

Is system a Geothermal?

No

Indoor

Thermostat

Current and capable of utilizing all of the system's features

Duct Leakage

No or insignificant amounts of air leakage

Duct Insulation

No or insignificant amounts of insulation missing

Evaporator Coil/Corrosion (Include picture)

No leaks or visible corrosion

Filtration System (Please List Size in Customer Information)

Media

PVC Is sch. 40

sch. 40 is a thicker rating of PVC which is less likely to crack or leak. It is especially recommended for systems located in attics.

Pass

Condensate Pump

N/A

Pump Tubing

N/A

Drain Pan

Good Condition

Water Safety System

Code Compliant, but without backup

Compressor amp draw under load (RLA)

3.52



Condenser fan motor amps (RLA)

.64



Subcooling

0

Superheat

19

Outdoor Unit is Level

Compressors in the outdoor unit contain oil, which must be kept level to function properly

Defrost Cycle

The defrost cycle melts off any ice that has accumulated on your outdoor unit to keep it operating at max capacity in the coldest weather. This will sometimes produce steam that can be mistaken for smoke.

Defrost Cycle operates properly

Power Is Restored And System Is Running

Yes

Overall System Health Score

5



Job #80857342

Maintenance Checklist (Main)

Heating or Cooling

Heating or Cooling?

Heating

What type of Heating?

Heat Pump

System Overview

Is system a Geothermal?

No

Indoor

Thermostat

Current and capable of utilizing all of the system's features

Duct Leakage

No or insignificant amounts of air leakage

Duct Insulation

No or insignificant amounts of insulation missing

Evaporator Coil/Corrosion (Include picture)

No leaks or visible corrosion

Filtration System (Please List Size in Customer Information)

Media

PVC Is sch. 40

sch. 40 is a thicker rating of PVC which is less likely to crack or leak. It is especially recommended for systems located in attics.

Pass

Condensate Pump

N/A

Pump Tubing

N/A

Drain Pan

Good Condition

Water Safety System

Code Compliant with backup

Condenser Coil Clean (Included with Membership)

The outdoor unit's coil must be clean to help minimize utility bills and maximize units life

Yes, I cleaned the coils and outdoor unit

Refrigerant Pipe Insulation

Good Condition


Compressor amp draw under load (RLA)

9.87



Condenser fan motor amps (RLA)

1.21

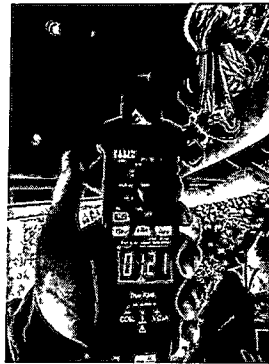

Subcooling

0

Superheat

16

Outdoor Unit is Level

Compressors in the outdoor unit contain oil, which must be kept level to function properly



Defrost Cycle

The defrost cycle melts off any ice that has accumulated on your outdoor unit to keep it operating at max capacity in the coldest weather. This will sometimes produce steam that can be mistaken for smoke.

Defrost Cycle operates properly

Power Is Restored And System Is Running

Yes

Job #47479697

Maintenance Checklist (Lennox) 2 MAIN AREA

Heating or Cooling

Heating or Cooling?

Heating

What type of Heating?

Heat Pump

System Overview

is system a Geothermal?

No

Indoor

Thermostat

Current and capable of utilizing all of the system's features



Duct Leakage

No or insignificant amounts of air leakage

Duct Insulation

No or insignificant amounts of insulation missing

Blower Amps

0.26



Blower Motor

Functional with no signs of high power usage

Blower Run Capacitor

NA

Disconnect Box

Good Condition

Flush Drain Line (Included with Membership)

The drain line should be flushed clean twice per year with a drain line cleaner to help prevent blockages

Flushed Drain Line (Included for Members)

Control Circuit Board

This board serves as the brain of your system

Pass

Voltage Transformer

This is the system that converts the power from the electric company into something that your unit can use.

Pass

Condenser Coil Clean (Included with Membership)

The outdoor unit's coil must be clean to help minimize utility bills and maximize units life

No, I did not clean (please write in why)

"We will clean them in the spring. They are clean now"

Refrigerant Pipe Insulation

Good Condition

Compressor amp draw under load (RLA)

10.71




Condenser fan motor amps (RLA)

1.14



Subcooling

18.7

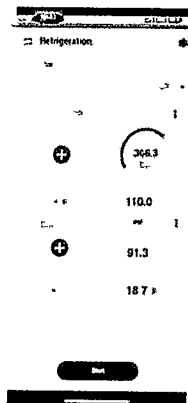

Job #47479697

Maintenance Checklist (Carrier) : ATTIC

Heating or Cooling

Heating or Cooling?

Heating

What type of Heating?

Heat Pump

System Overview


is system a Geothermal?

No

Indoor

Thermostat

Current and capable of utilizing all of the system's features

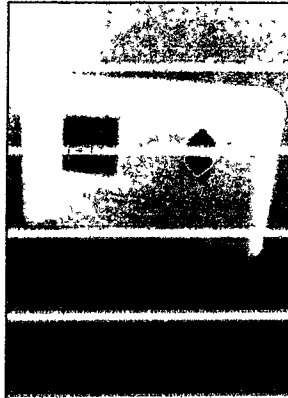

Duct Leakage

No or insignificant amounts of air leakage

Duct Insulation

No or insignificant amounts of insulation missing

Evaporator Coil/Corrosion (Include picture)

No leaks or visible corrosion

Filtration System (Please List Size in Customer Information)

Media

Condenser Coil Clean (Included with Membership)

The outdoor unit's coil must be clean to help minimize utility bills and maximize units life


No, I did not clean (please write in why)

Refrigerant Pipe Insulation

Good Condition


Compressor amp draw under load (RLA)

5.73

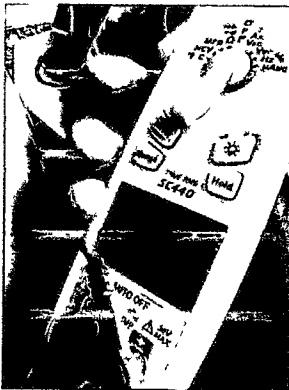


Condenser fan motor amps (RLA)


.4

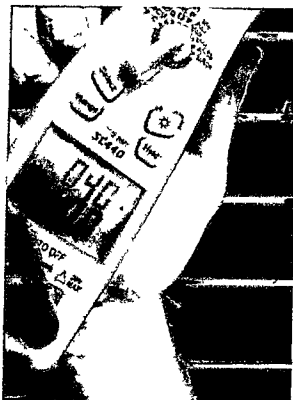

Subcooling

10

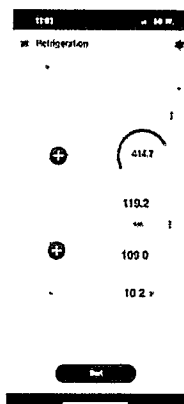

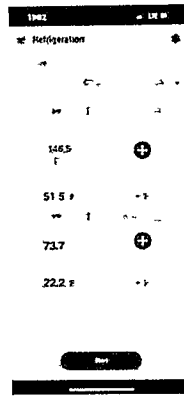

Outdoor Unit is Level

Compressors in the outdoor unit contain oil, which must be kept level to function properly

Defrost Cycle

The defrost cycle melts off any ice that has accumulated on your outdoor unit to keep it operating at max capacity in the coldest weather. This will sometimes produce steam that can be mistaken for smoke.

Defrost Cycle operates properly

Power Is Restored And System Is Running

 Yes

Overall System Health Score

5

Top Concerns

None

Additional Notes

-



Stanfield Air Systems
 1130 Mitchell Bridge Rd.
 Athens, Georgia 30606
 (706) 549-4767
 www.stanfieldair.com

BILL TO

Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

INVOICE	INVOICE DATE
80863779	Jun 04, 2025

JOB ADDRESS

Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

Billing Date:

Payment Term: Due Upon Receipt

Due Date: 6/4/2025

TASK	DESCRIPTION	QTY	PRICE	TOTAL
MA-HVAC-S2	HVAC Maintenance Sale 2 system	1.00	\$22.00	\$22.00

PAID ON	TYPE	MEMO	AMOUNT
6/4/2025	Visa		\$22.00

SUB-TOTAL	\$22.00
TOTAL DUE	\$22.00
PAYMENT	\$22.00
BALANCE DUE	\$0.00

Thank you for choosing Stanfield Air Systems

CUSTOMER AUTHORIZATION

This invoice is agreed and acknowledged. Payment is due upon receipt. A service fee will be charged for any returned checks, and a financing charge of 1.5% per month shall be applied for overdue amounts.

Sign here _____

Date _____

CUSTOMER ACKNOWLEDGEMENT

I find and agree that all work performed by Stanfield Air Systems has been completed in a satisfactory and workmanlike manner. I have been given the opportunity to address concerns and/or discrepancies in the work provided, and I either have

Filters Delivered

2700 Hutchison McDonald Rd #D
Charlotte, NC 28269



Ship To: Sharon L Pfeiffer
127 BORDEAUX LN
ATHENS, GA 30605-7042 US

Order # 112-0850098-3246618
Date 5/29/2025

Item	Description	Price	Qty	Ext. Price
FDAMZ4M1320204	20x20x4 MERV 13 AC & Furnace 4" Depth Air Filters. Box of 4. Actual Size: 19-1/2 x 19-1/2 x 3-3/4	\$99.95	1	\$99.95

Sub Total: \$99.95
Tax: \$8.00
Shipping: \$0.00
Total: \$107.95

Thank you for buying from FiltersDelivered on Amazon Marketplace.

Returning your item:

Go to "Your Account" on Amazon.com, click "Your Orders" and then click the "seller profile" link for this order to get information about the return and refund policies that apply.

Visit <https://www.amazon.com/returns> to print a return shipping label. Please have your order ID ready.

Thanks for buying on Amazon Marketplace. To provide feedback for the seller please visit www.amazon.com/feedback. To contact the seller, go to Your Orders in Your Account. Click the seller's name under the appropriate product. Then, in the "Further Information" section, click "Contact the Seller."



Stanfield Air Systems
 1130 Mitchell Bridge Rd.
 Athens, Georgia 30606
 (706) 549-4767
 www.stanfieldair.com

BILL TO
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

INVOICE 78161278	INVOICE DATE Apr 02, 2025
----------------------------	-------------------------------------

JOB ADDRESS
 Ed Pfeiffer
 127 Bordeaux Lane
 Athens, GA 30605 USA

Completed Date:
Payment Term: Due Upon Receipt

DESCRIPTION OF WORK


Performed cool PSA one two systems. Both system electrical amp draws were within proper range as well as capacitor readings are nominal. When changing filters saw one was the wrong size and included proper dimensions in emailed pictures. Refrigerant pressures read according to manufacturer charts. When trying to rinse outdoor units the hose access outside wasn't functional at the time. Everything with the two systems is functioning properly at this time, thank you. - Tristan

TASK	DESCRIPTION	QTY	STANDARD PRICE	PRICE	TOTAL
Visit Complete	Maintenance Visit Complete	1.00	\$134.00	\$134.00	\$134.00
Visit Credit	Maintenance Visit Credit for prepaid agreement	1.00	\$-134.00	\$-134.00	\$-134.00
FIL-101	Change Customers Merv 11 media filter all sizes	1.00	\$71.00	\$60.35	\$60.35

MEMBER SAVINGS	\$10.65
SUB-TOTAL	\$60.35
TAX	\$4.83
TOTAL DUE	\$65.18
BALANCE DUE	\$65.18


Thank you for choosing Stanfield Air Systems
CUSTOMER AUTHORIZATION



This invoice is agreed and acknowledged. Payment is due upon receipt. A service fee will be charged for any returned checks, and a financing charge of 1.5% per month shall be applied for overdue amounts.

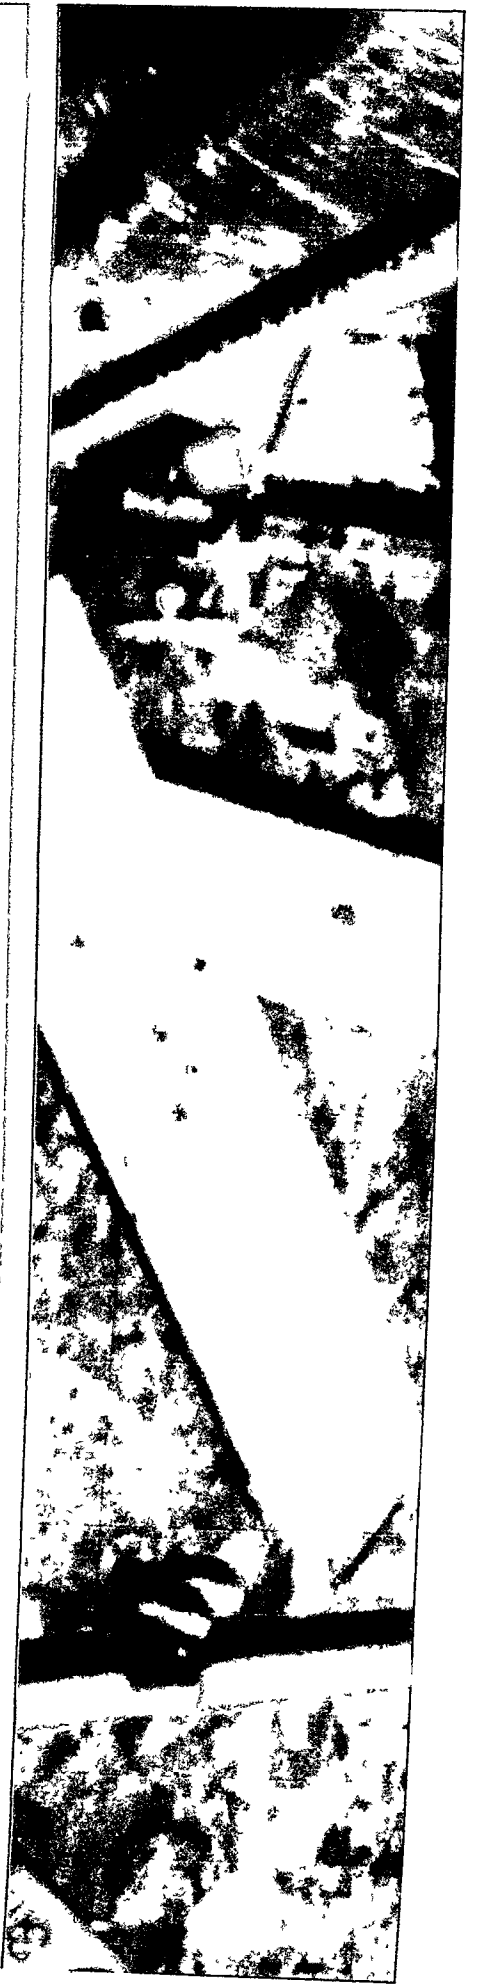

20 X 20 X 4

Actual Size: 19½ X 19½ X 3¾ ~ 49.5cm X 49.5cm X 9.5cm

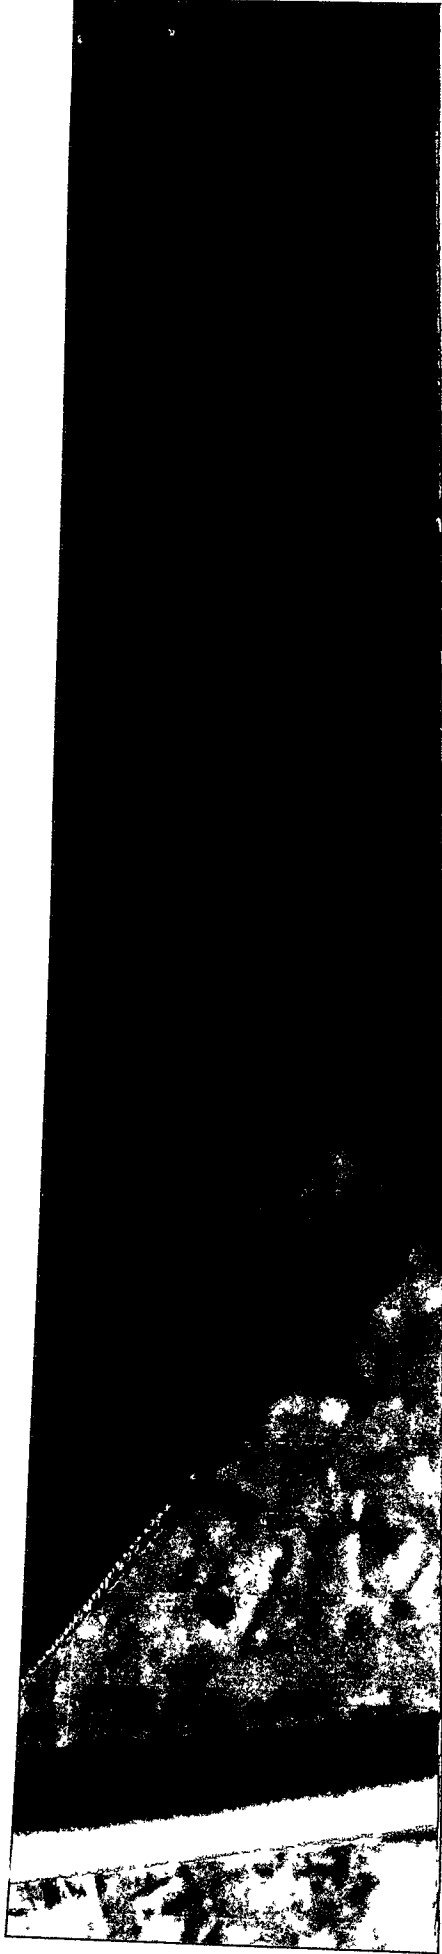

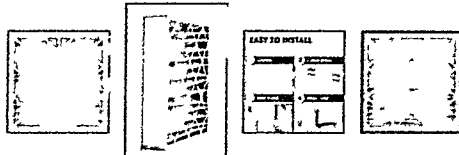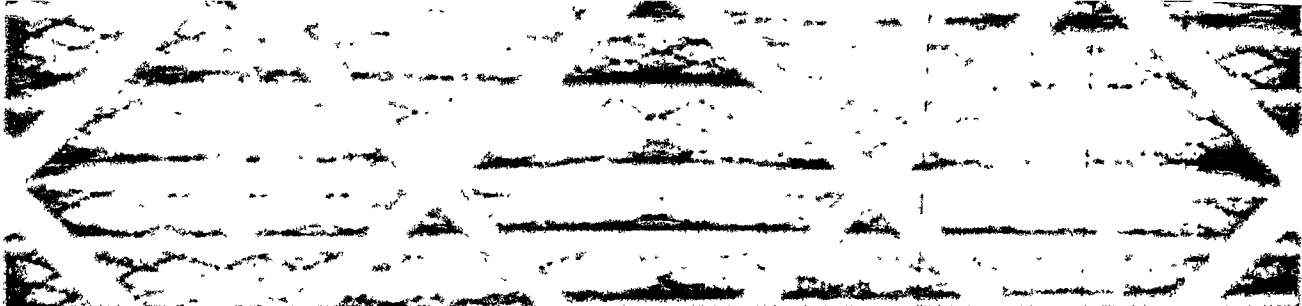

20x20x4 Commercial HVAC Air Filter

~~\$77⁹⁰~~

\$58⁹⁹



MERV 13
HEALTH

★★★★★ 4.8 | 8 Reviews

Select Your MERV Rating:

Clean

MERV 8

Traps: lint, dust, mold spores

0



Find filter by size or brand



Account





Cart



Find filter by size or brand



Wholesale

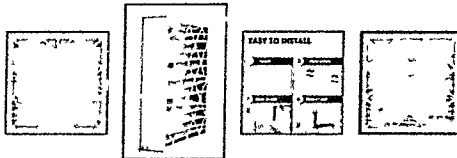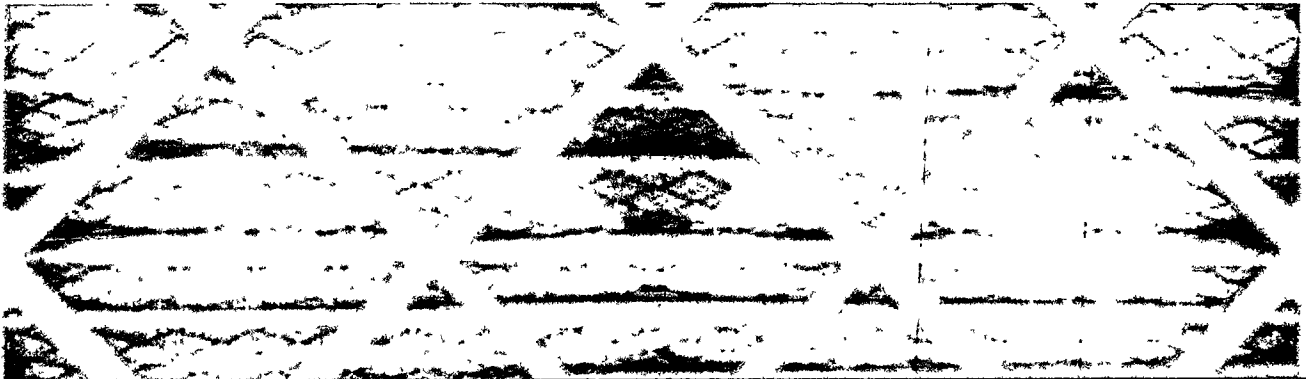

20x20x4 Commercial HVAC Air Filter

~~\$69⁷⁵~~

\$52⁹⁹



Allergy

MERV 11

*Pollen, Pet Dander
Smoke*

★★★★★ 4.8 | 8 Reviews

Select Your MERV Rating:

Clear

MERV 8

Traps lint, dust, mold spores

